

*Remington.*



**REMINGTON ARMS COMPANY, INC.**

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

May 2, 1986

Allison & Carey Gun Works  
10218 S.E. Powell Blvd.  
Portland, Oregon 97266  
Attn: Mr. Don Carey

Dear Mr. Carey:

Examination has been completed on your customer's Model 700 rifle, in 6.5 Rem. Mag. caliber, serial number 6213363, which you returned for an alleged firing upon bolt closing problem.

Our experts advise that the trigger assembly sear lift is at .065" which is good and within specification.

However, analysis showed that the trigger and sear have been worked on outside our factory. The trigger shows much overtravel and has a very light 2½ pound pull which is way below Remington specifications.

Although all trigger components are correct with no defects, the overtravel and poundage adjustment screws have been backed out of the trigger assembly, again, outside of the Remington plant. The overtravel adjustment is especially excessive.

Based on these findings, Remington Arms Co., Inc. is not responsible for your customer's unfortunate incident. However, as a no-charge gesture of good will, we'll re-adjust the trigger to Remington specifications or we'll replace the trigger assembly, also at no charge, with your customer's permission. Please note that present replacement triggers do not have the bolt lock feature.

Thank you for giving us the opportunity to be of service, Don, and we wish you every business success. We await your reply.

Sincerely,

R.H. Potter, Supervisor  
Product Service

RHP:tpp