

RECEIVING AND ESTIMATING REPORT

COMMENTS

L CUSTOMER ORDER NO.

RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

MODEL AND GRADE

ORDER

7/05/91

06/10/91

BU 1-71

6400232

700

243

BDL

R

91-12162

SSORIES

W/STUDS

L/REAR SIGHT

M:

SHIP TO:

CARLS RELOADING CENTER
435 EAST 3RD NORTH
RICHFIELD

UT 84701

CARLS RELOADING CENTER
435 EAST 3RD NORTH
RICHFIELD

LIT
84701

JUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

UPS

AIR CHARGE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

IN CONDITION:

☐ NEW

☐ SLIGHTLY WORN

☐ VERY WORN

☐ MISUSED

☐ MARRED

COMER'S REQUEST

fires when safety is moved.

N FAULT

Could not duplicate complaint after many attempts! However, removal of action from stock revealed trigger assembly had been tampered with inside factory. Sealant on adjusting screws was not original. Overtravel had been altered and was insufficient. Trigger pull 3 pounds; run lift 0025"

We can either re-adjust over-travel and return rifle or, we can install a new trigger assembly at \pm normal cost, as a gesture of good-will, if it will better restore confidence in the rifle.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV. 7/90

PPS 00892