

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
GENERAL CONDITION: GOOD R #: 01780
OUTSIDE WORK: SCOPE MOUNTED, REAR SIGHT DATE: 1-26-71
LEAF REMOVED. FROM: GREEN BROOK SPT. SHOP
FIRED AMMO TYPE: _____ GREEN BROOK, N.J.
& CONDITION: _____ GUN #: 6362025
PROOF: R.E.P.-E INSP.: 74 TEST: 87 CODE: WT = 8/70
HEADING: O.K. GA./CAL.: 7MM MAG.
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____
COMPONENTS O.K.

COMPLAINT: "UPON RELEASING THE SAFETY MAY FIRE"

INCIDENT: FOLLOW DOWN

COMMENTS: THE MALFUNCTION CAN NOT BE DUPLICATED,
HOWEVER, THE SEAR - CONNECTOR ENGAGEMENT IS NOT
TO SPECIFICATION (.008 SHOULD BE .015 MIN.) THIS COUPLED
WITH ANY TRIGGER BIND, SUCH AS TOO HEAVY LUBRICANT,
MIGHT CAUSE A MALFUNCTION. ENGAGEMENT
CORRECTED.