

RECEIVING AND ESTIMATING REPORT

CUST NO 050228 C.O.D		COMMENTS STK HAS A CRACK IN IT	
INITIAL LCS	CUSTOMER ORDER NO.		
DATE RECEIVED 09/26/91	DATE OPENED 10/02/91	DATE CODE DH 9-87	SERIAL NUMBER B6892247
MODEL AND GRADE 700 25-06		ADL	
ACCESSORIES W/STUDS		SCOPE BASE	
ORDER R 91-1950			

FROM:	SHIP TO:
YODER, RAY RT 1 BOX 99 800 E BREEDLOVE DR STURGEAN USA	YODER, RAY RT 1 BOX 99 800 E BREEDLOVE DR STURGEAN USA
MO 65284	MO 65284

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐ TARP	PROM. DATE	ESTIMATED 10-14-91	VIA UPS
----------------	--------------------	-------------------------------------	------------	-----------------------	------------

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	-----	-----------	-----	-------------	-------

GUN CONDITION:	☐ NEW	☐ SLIGHTLY WORN	☐ VERY WORN	☐ MISUSED	☐ MARRED
----------------	------------------------------	--	------------------------------------	----------------------------------	---------------------------------

CUSTOMER'S REQUEST

when putting safety off it will fire without pulling trigger

MAIN FAULT
As received, rifle would not cock on closing bolt. Removal of action from stock revealed trigger has been improperly adjusted out of position. 1) insufficient rear engagement 2) insufficient rear travel. Stock has cracked under magazine well - it appears rifle was disassembled and improperly re-assembled at sometime, causing crack. Magazine may not have been properly seated.

1) send quotation for new trigger assembly at a normal cost, as gesture of good-will
2) check as to feasibility of repairing stock.

REPAIRMAN DL	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY