

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R 92-24645

INITIAL CUSTOMER ORDER NO.

JJM 23375

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

11/12/92

11/17/92

LA 2-80

A6857301

700 30-06

BDL

ACCESSORIES

W/STUDS

SCOPE BASE

L/REAR SIGHT

FROM:

SHIP TO:

HUNTINGTONS SPTSMAN
601 ORD DAM BLVD
PO BOX 991
OROVILLE

CA 95965

HUNTINGTONS SPTSMAN
601 ORD DAM BLVD
PO BOX 991
OROVILLE

CA

95965

CUST NO: 000228 WILM L

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

12-1

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	B1				
TRIGGER GROUP	1) "in fire" when the safety was taken off"	B2			E1	
BOLT ASSY.		B3			E2	
BARREL ASSY.	2) "Also install a safety that lets the bolt open when it's on".	B4			E3	
REC. ASSY.		B5		D2	E4	F4
WOOD			C1	D3	E5	F5
METAL			C2			

MAIN FAULT

Could not duplicate complaint. However, removal of the action from the stock revealed that the trigger assembly had been improperly adjusted outside factory. Trigger retention is not inconsistent with positive, because weight of full screw is backed out too far. This condition could possibly account for the complaint that was noted.

Trigger pull 3 1/2 pounds; rear lift .009"

PARTS

COMMENTS

Ph. Lib -
Copy to Suppy

1) Offer to replace trigger assembly with new style (no bolt lock) for 1/2 mm cost, as gesture of good-will.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

JBT

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV. 1/92

PS03012