

RECEIVING AND ESTIMATING REPORT

COMMENTS

Product
ServiceORDER
R 94-25350

INITIAL CUSTOMER ORDER NO.

FES

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

09/01/94

09/02/94

RA 1-80

A4873720

700 270 WIN

BDI

ACCESSORIES

L/SIGHTS

L/STUDS

FROM:

SHIP TO:

ISRAEL, CHESTER L.
103 PARKWOOD
LEVELLAND

TX 79336

ISRAEL, CHESTER L.
103 PARKWOOD
LEVELLAND

TX

79336

CUST NO: 102824 C.O.D.

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

059001

WRITE ☐

FROM DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☒ NEW *new*
- ☐ LIGHTLY WORN
- ☐ WORN
- ☐ VERY WORN
- ☐ UNREPAIRABLE
- ☐ MARRED

REPAIR CHARGE *45.00*

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

TRIGGER GROUP

BOLT ASSY.

BARREL ASSY.

REC. ASSY.

WOOD

METAL

MAIN FAULT

1) Gun went off 2 to 3 seconds after chambering round.

2) Gun went off when user was using it.

3) Bolt sec # does not match gun sec #

Major 1/80 No fault found with trigger assy. Headspace is excessive with the breech bolt that is in gun. May have had delayed firing due to light firing pin indent. Install new breech bolt to set proper headspace.

PARTS

COMMENTS

Trigger pull measured 4 1/4 LBS or less. Breech lift was .011

Wring bolt in gun as reqd.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV. 1/94

PS03283