

# RECEIVING AND ESTIMATING REPORT

COMMENTS  
ATTN J STEKL

INITIAL JJM	CUSTOMER ORDER NO.		DATE RECEIVED 09/07/90		DATE OPENED 09/19/90	DATE CODE DR 9-68	SERIAL NUMBER 368540	MODEL AND GRADE 700 30-06 BDL		ORDER R 90-24158
ACCESSORIES W/STUDS		SCOPE BASE								

FROM:

RAYCO SALES  
9105 MENDENHALL MALL RD  
JUNEAU AK 99801

SHIP TO:

RAYCO SALES  
9105 MENDENHALL MALL RD  
JUNEAU AK  
99801

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE <input type="checkbox"/>	PROM. DATE	ESTIMATED	VIA V409556133
----------------	--------------------	--------------------------------	------------	-----------	-------------------

REPAIR CHARGE						TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	--	--	--	--	--	-----	-----------	-----	-------------	-------

GUN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☒ VERY WORN ☒ MISUSED ☐ MARRED

CUSTOMER'S REQUEST: *"This rifle discharged while the owner was raising the bolt handle to extract a cartridge"*

MAIN FAULT: *Rifle has not been properly maintained - trigger assembly is contaminated with oil and gumming residue (as is bolt & firing pin assembly). Movement of internal trigger parts is sluggish, even at room temperature. Cold temperatures combined with contamination could possibly cause mal-function. Trigger pull 4.5, near lift .008". Could not duplicate complaint.*

*Clean trigger assembly, if possible. If not, send replacement trigger assembly at 1/2 normal price, as gesture of good-will.*

9/21/90  
JLS

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE