

RECEIVING AND ESTIMATING REPORT

COMMENTS

Product Service

ORDER
R 94-33911

INITIAL
JJM

CUSTOMER ORDER NO.
43138

DATE RECEIVED
11/22/94

DATE OPENED
11/28/94

DATE CODE

SERIAL NUMBER
LE894159

NEW SERIAL NUMBER

MODEL AND GRADE
SP10 10-30

RC/VT

ACCESSORIES
W/STUDS

EJ 10-89 2ND TIME

FROM:

SHIP TO:

SODAK SPORT & BAIT
850 S HWY 281
ABERDEEN

SD 57401

SODAK SPORT & BAIT
850 S HWY 281
ABERDEEN

SD
57401

CUST NO:006177 WILM

ACCOUNT NUMBER

ACCOUNT NUMBER N/C
059015

WRITE ☐

PROM. DATE

ESTIMATED
11-30-94

VIA

UPS

GUN CONDITION

☐ NEW

☒ LIGHTLY WORN

☐ WORN

☐ VERY WORN

☐ UNREPAIRABLE

☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

TRIGGER GROUP

BOLT ASSY.

BARREL ASSY.

REC. ASSY.

WOOD

METAL

MAIN FAULT

After 10/89 Gun was tested for slam fire condition, worst case muzzle down and we could not duplicate a condition where a primer would detonate. (No Fault Found) Gun performed to design specification. Cause may have been ammo-related or a foreign object may have been involved. Replace fore end at R/C as a gesture of good will.

PARTS

COMMENTS

*fore end Assy.
Rec'd incident shell on 11/1/95
Incident on incident shell is normal in every respect,
way too deep for a 'slam fire' or a follow down.
Gun had to be locked up and trigger pulled with
safe off.*

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV. 1/94

PS05381