**,** '

## Remington Arms Co., Inc. Product Service Legal Case #:2865

Case Inform	nation									
<b>RE#</b> 154568		<b>Opened</b> 0/2008		Opened(PS) 1/12/2008	Date Clo 11/12/20		Inc	ident Date	Pre Lit L	it Obsolete
Customer In	nformati	on								
Type Bu	siness	First Name	Last Name	Street	City	State	Zip	Age	Contac	t
Incident		Kim	Martin	202 Haywood St	Asheville	NC	28801	Kim.N	W 828-250- E Aartin@Buncon	4430 nbeCounty.Org
Incident Inf	ormatio	n								
Cla	ims			Codes			Repai	ir Est. Medi	cal Treatment	Medical Status
PI PD S Fires or release C	n safe		<sup>:4006</sup> (	Altered Adjustment Components Fired on Safe Relea					Unknown	

11/14/08 Trigger pin is "slap firing" and will not reset in bolt. When the bolt is moved forward and a round chambered the firing pin moves forward and fires. If the sfety is engaged when the bolt is closed on a round, disengaging the safety causes the round to fire.cm

Firearm Informati Mfg.	ion <b>Type</b>	Model/Ga.	SKU	Serial	Bbl.	<b>DOM</b> 1/17/2001 2:12:21
Remington	CF/BA	700/308 WIN	25709	E6698785	BV	PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	BUNCOMBE COUNTY SHERIFF S	SCOPE BASE	U			
CONCERN:FBC						

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement - None Defined

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		11/12/2008
Examination	Product Type		RF
	Action Type		Α
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	SET SCREWS ALTERED
	Description		26" 308 WIN HB
	Date Code		BV
	Bore Plugged	False	
	Bulged	False	

. . .. . . <del>..</del> . . .

•

.

 
	Fired	False	]
Barrel	Fired while Obstructed		-
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	CAMO PAINTED
Overall	Stock Condition	Slightly Worn; Functioning	CAMO PAINTED
	Fore End Condition	Select	
n:	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	N/A
Sear	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
	Condition	Slightly Worn; Not Functioning	TRIG RUSTED WON'T RETURN PROPERLY
Trigger	Pull	Select	5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

 
~

 
Repair Inquiry				
Repair Number <b>RE 00154568</b> Verify Repair	Senal: E6538785 Model 700 Center Fire 308 WIN Produced: 01/17/2001		BuceTravis 11/12/2008-10-11:15 AM	
Address Information Customer: Name: KIM MARTIN	and a subset of the	tumio ⊖assi MMARTIN	C Received From	
Address 1 202 HAYWOOD STREET Address 2: City ASHEVILLE		12 Haywood Street	Boxd Country/US	
State: NC Zip Code: [29801	FFL [			
Date         User ID         Desci           11/4/2008/7:38:1         valentds         Repair           11/10/2008/9:51         pencert         From           11/10/2008/9:51         pencert         From           11/12/2008/7:50         dekanekcg         From           11/12/2008/10:01         Travisbw         Repair           11/12/2008/10:01         Travisbw         Estimation           11/12/2008/10:02         pencert         From           11/12/2008/10:02         pencert         From	robleme Estimate Desc2 i Added Desc2 Check In To: Repair Bench Repair Bench To: i Maintenance Status: Estimating ate Update Status: PartsHold Product Services To: PartsRack	InterFace Hold     Estimate Serv     Parts Received     Passed Inspection     Return As Received     Has been Approved     Internal Repair	Shipping / Billing Current Status PartsHold 11/12/2006/10.11.15/AM Triavisbw PartsFlock Repair Location LIN Current Location Tiansfer Number	
Repair Search		<u>Refr</u>	esh Close , Brandiska (	
	/2008			

This is being repaired at N/c as a gesture of good will.

General Repair Form







Back to Repair Services

annaou

General Repair Form

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: Rem 700	Serial Number: E6698785	5				
Name: Lt. Kim Martin	Date of Purchase: Unkno	Date of Purchase: Unknown				
Address (no PO Boxes): 202 Haywood Street						
City: Asheville	State: NC	Zip: 28801				
Phone (Daytime): 828-250-4430	Fax:	· · · · ·				
E-mail Address: Kim.Martin@BuncombeCounty.Org						
chambered the firing pin moves forwards and fires the round boll is closed on a round, disengaging the safety causes the		ne				
222 characters left						
NOTE: Prior to shipping your firearm, contact the Repair Cen	iter for services provided and estin	mated repair time.				
WARNING: DO NOT SEND LIVE OR SPENT SHELLS I FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF Y THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, A SERIAL NUMBER OF YOUR FIREARM.	OU FEEL YOU MUST SEND SPE	ENT SHELLS PLEASE SEND				
<ul> <li>Record the serial number of your firearm before sending it.</li> <li>Pack your firearm for safety and to prevent further damage firearm box. (Nole: Original boxes may not be returned.)</li> <li>Remove all accessories from your firearm to prevent loss of Ship your ENSURED firearm by either UPS or Parcel Post during shipment, so you may elect to purchase insurance in</li> </ul>	e in shipping and handling. Prefera or damage. . Remington is not responsible for					

©2008 Remington Arms Company, Inc. All Rights Reserved. Investor Relations | Other Remington Brand Products | Legal Notices | About Us



Visit Our Other Websites Other Sites TILIG. Set SCREWS ALTERED TRIG. HTRIG. PIM RUSTED. TRIG WOR'T NETURN. Check oner, clean + replace TPA AT H/c 6002-W. II gesture.

# 230145