			Re	emington Arms	Co., Inc.						
				Product Serv	vice						
				Legal Case #:	1924						
Case Inform	ation										
RE#	Date C)pened I	Date Opened(PS)	Date C		Incide	nt Date	Pre	Lit Li	t 0	bsolete
138946	12/28	/2007	1/3/2008	1/3/2	008						
Customer In	nformation				•						
Туре	Business	First Name	Last Name	Street	City	State	Zip	Age	С	ontact	
Reporter		Joseph	Quiroz	495 Garfield PO Box 1260	Lander	WY	82520)-990-0 7-332-9 300droi	0173
Incident Inf	ormation		•								
	Claims		Codes		Repair	r Est.	Medica	l Treatm	ient N	/ledica	l Status
PI											
PD		Caus	se:4015 Imprope	r Maintenance			T.	.1			
S fires	on safe rele	ease Con	cern:1007 Fired on	Safe Release			U	ıknown			
С											
1/9/08-corre	espondence	from repair-cust s	sending in for SMP	. rifle fires when	n the safety is	s release	d.lw				
Firearm Info	ormation										
Mfg.		т	уре	1	Model/Ga.		S	KU	Serial	Bbl.	DOM
Reming			S/BA	-	MM REM N	ΛA		000			2/1/1970
Date Purc			Purchased		Accessories			l Owner			
	SI	MMONS GUN S	PEC OLATHE KA	N TWO PIE	ECE SCOPE	BASE	-	U			
CONCERN	FSR:										
Ammunitio	n Informati	on - None Defined	1	-							
		ation - None Defin									
Settlement											
Sentement			1	Remington/700/	CF/BA						
				-			Cash	R	eim. Date	Ca	sh Date
Settler	nent	Release of Cla	ims Rel	ease Date	Reimburse	ment	Settleme		APV		APV
Replace T SM											
		Repair/Replace Cost	ment Repair/	Replacement Date							·
1/9/08-repla	ace ta under	smp for 20.1w									

Examination[Remington/CF/BA]

Part Sub-Part		Code	Comment
	Examiner		B.TRAVIS
	Exam Date		1/3/2008
Examination	Product Type		RF
	Action Type		Α
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	TRIG ASSM VERY DIRTY STICKY,TRIG BINDS FOLLOWS DOWN
	Description		24" 7MM REM MAG SS
	Date Code		LT
Barrel	Bore Plugged	False]
	Bulged	False]
]

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=1924&Type=Case

1/9/2008

 
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False]
	Block Condition	Select]
Locking	Lug Condition	Slightly Worn; Functioning]
	Notch Condition	Select]
	Exterior Condition	Worn; Functioning]
Overall	Stock Condition	Worn; Functioning]
	Fore End Condition	Select] .
Receiver	Condition	Worn; Functioning]
Keceiver	Bulged	False]
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning]
	Lift	Select	.008
Sear	Notch	Like new; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	VERY DIRTY/STICKY
Trigger	Pull	Select	10+#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

STArms Service: Repair @ Estimate System	
File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR	Tools Reports Table Maintenance System Maintenance Help
Repair Number: RE00138946 Serial: 6313931 Model 700 Center Fire MM REM. MAG. Produced: 03/02/197	
Verity Repair	Status: New 1/2/2008 10:23:19 AM
Address Information	Return To
	JOSEPH R. QUIROZ
	495 GARFIELD
Addiess 2. PO Box	LANDER PO Box
State: WY Zip Code: 182520 County: US State:	WY Zip Code: (82520 Country US
[가슴 특징 4월 1997] 이 나는 것 이 가슴이 [16]	
Contact / Condition Broblems	History / Status Shipping / Billing
Desc1	Current Status
S 1/2/2008 10:23:1 sanguinegf ' Repair Added	Shipping Hold New ∫ Jintelf ace Hald J1/2/2009 10,23:19 AM
1/2/2008 10:26:C sanguinegf From Check In To: 17/2/2008 12:05:C ArmEmail Repair Received J0E@G00DR	00TS.NET Estimate Sent Product Services
1/2/2008 12:05:1 ArmEmail Receipt JOE@GDDDR 1/3/2008 12:51:C supryfl Returned to AS for repair Bolt lock modifi	OUTS.NET J Parts/Received Repair Location
	icalion program IT Passed Inspection ILN Return As Received Current Eccation
	EN Has been Approved
A Contraction of the second	Transfer Number
Repair Search	<u>Refresh</u> <u>Close</u>
	in the second second An environment of the second second A second seco
	드러가 가장 이상은 동안이 있는 가장은 이는 가장은 이 가장이 있는 것은 것을 가지 않는 것을 가장한 것을 가장한 것을 가장한 것을 수 있다. 이 가장은 것은 것을 하는 것은 것을 하는 것을 가장한 것을 가장한 것을 수 있는 것을 가장한 것을 가장한 것을 가장한 것을 가장한 것을 수 있다. 이 가장은 것은 것은 것을 하는 것은 것을 하는 것을 하는 것을 하는 것을 수 있는 것을 수 있는 것을 하는 것을 수 있다.
supryfl 1/3/2008 [1251; PM // // // //	STATUS INUM
USER - ObligeRiccidectar (19) Biblionars	



Back to Repair Services

MMYOR



General Repair Form

NOTE: Please complete and print this form, and then include it with your firearm

	/				
Model Number: 700 BDL	Serial Number: 6	Serial Number: 6313931			
Name: Joseph R. Quiroz	Date of Purchase	Date of Purchase: ~1970			
Address (no PO Boxes): 495 Garfield					
City: Lander	State: WY	Zip: 82520			
Phone (Daytime): 520-990-0956	Fax:	Fax:			
E-mail Address: joe@goodroots.net					
Also, I request you check the safety and trigger mechanism. The firing mechanism sometimes will not cock even if the s. However, if the safety is engaged while the bolt is back (act When the safety switch is then pushed forward in preparatie activates immediately. 361 characters left	afety is left in the fire posi lion is open), the mechani	tion. ism will cock.			
NOTE: Prior to shipping your firearm, contact the Repair Ce WARNING: DO NOT SEND LIVE OR SPENT SHELLS FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF THEM IN A SEPARATE PACKAGE AND INCLUDE NAME. SERIAL NUMBER OF YOUR FIREARM.	IN YOUR FIREARM OR YOU FEEL YOU MUST S	IN THE SAME BOX WITH THE END SPENT SHELLS PLEASE SEND			
 Record the serial number of your firearm before sending it Pack your firearm for safety and to prevent further damage firearm box. (Note: Original boxes may not be returned.) Remove all accessories from your firearm to prevent loss Ship your ENSURED firearm by either UPS or Parcel Pos during shipment so you may elect to purchase insurance 	e in shipping and handling or damage. t. Remington is not respoi				

Model: 700 RE00138946

About Us

Visit Our Other Remington Websites Other Sites

Trig ASSM. Very Dirty/STICKY. Follow down. Replace TRA, check over, clean under BOLT LOCIE program Ron \$ 20.00 + SKH Quote

http://www.remington.com/support/repair_services

December 12, 2007

Remington Arms Company, Inc. Ilion Firearms Plant Attention: BL Safety Program 14 Hoefler Avenue Ilion, NY 13357

Re: Remington 7mm magnum, model 700 BDL ser# 6313931

I am returning this rifle to you under the bolt-lock safety modification program.

As you can see my 7mm mag has had a lot of use over the years. Recently while at the local range, I noticed that the firing mechanism would not cock when I worked a shell into the chamber.

I learned that the firing mechanism will cock if the safety is switched on while the bolt is back, but not if the safety switch is left in the fire position. However, once the safety is pushed forward to the fire position, the rifle fires immediately without having to touch the trigger.

Fortunately, I did this with no shell in the chamber. I talked to a local gunsmith about it and he said he had heard of a couple of accidents with the 700 possibly arising from this problem. It seems to me to be advisable that customers should be warned about this potential issue if you have seen it in other rifles of this style.

I hope the bolt-lock modification will solve the problem, but I would ask you to look the mechanism over carefully to make sure that the problem is corrected.

Please contact me if there are any questions about repairs needed for this rifle.

Sincerely,

Joseph R. Quiroz

PO Box 1260, or street address - 495 Garfield Lander, WY 82520 joe@goodroots.net 520-990-0956 307-332-9173