Remington Arms Co., Inc. **Product Service** Legal Case #:2621

Case Information

Obsolete RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit 8/18/2008 8/19/2008 8/19/2008 149243

Customer Information

Contact City **Business First Name Last Name** Street Zip Age H 570-966-9331 John Bachorski 682 Wildwood Road Mifflinburg PA 17844 Reporter E dnbachorski@msn.com

Incident Information

Medical Treatment Medical Status Claims Codes Repair Est.

PΙ

Cause:4015 Improper Maintenance PD Trigger guard broken fired on safe release

Unknown Concern: 1007 Fired on Safe Release

C

Trigger and trigger pin were rusted. Trigger would not return under sear.

Firearm Information

Mfg. Model/Ga. SKU Serial Bbl. DOM Type 600/308 WIN 14327 PL 6/1/1964 Remington CF/BA Where Purchased Accessories **Original Owner Date Purchased**

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/600/CF/BA

Reim. Date Cash Date Cash Settlement Release of Claims **Release Date** Reimbursement Settlement APV APV

Special Price repair

Repair/Replacement Cost Repair/Replacement Date

8/19/2008 65.00

8/19/2008 trigger and trigger pin were rusted, trigger would not reliably return under sear. Returned to AS for special price repair - clean action and install new TA at 1/2 normal charges as gesture of goodwill fls.


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		8/19/2008
Examination	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	TRIG AND TRIG PIN RUSTED
	Description		18.5" 308 WIN
	Date Code		PL
Barrel	Bore Plugged	False	
	Bulged	False	
	Fired	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=2621&Type=Case

8/20/2008

•	Final - :: Observato	al	
	Fired while Obstructe Muzzle/Crown Condition	Slightly Worn; Functioning	· · · · · · · · · · · · · · · · · · ·
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	<u>,</u>
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False]
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
n	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
Safety	Description		STANDARD M/600 SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.009
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIGGER GUARD BROKEN N/S TRIGGER ASSM PLATING IS LIFTING ON SEAR
	Pull	Select	8#
	Altered	False	
	Sub-Assembly	Other Remington	Ī .

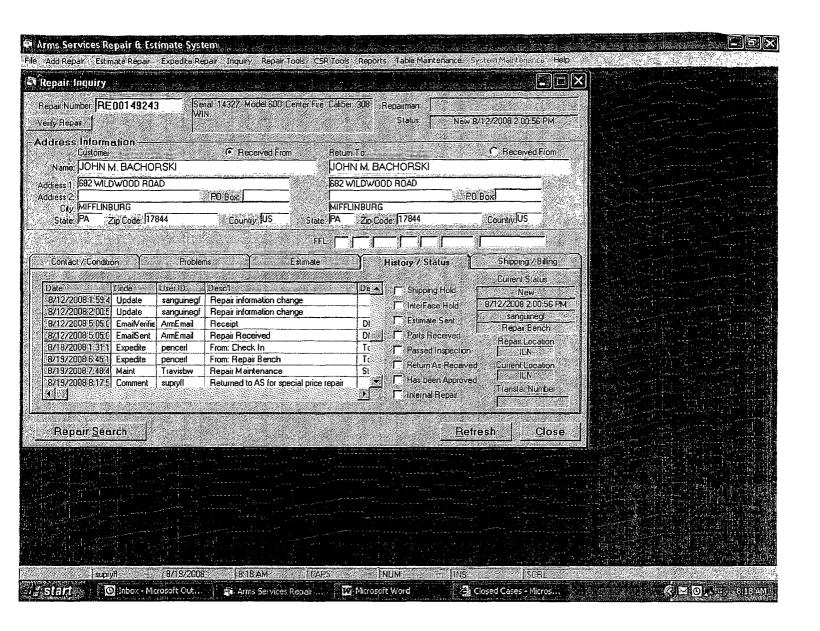

June 17, 2008

Dear Remington,

The reason I'm returning this 308 Win. Model 600 is due to the fact that the safety mechanism was malfunctioning. I proceeded to get it fixed. Then apon using it again the safety mechanism still malfunctioned. It fires when going from safe to fire position, occasionally. As a result the trigger gaurd was broken. So I'm returning it to you because this gun is a safety issue. Could you please look at it and deem it safe either by repairing it or replacing it.

Please contact me by mail: John M. Bachorski
682 Wildwood Road
Mifflinburg, PA 17844

by phone : (570) 966-9331

by E-Mail: dnbachorski@msn.com

Thank you for helping me with this matter.

Sincerely,

John M. Bacharski

Model (00, 308 wine Revial # 1432)

14327 Model: 600 Trig. + Trig. pin ilusted, Trig. will not return properly. Replace TPA, check over, clean At 1/2 Normal charges. Quote