Remington Arms Co., Inc. **Product Service** Legal Case #:2703

Case Information

Obsolete Lit RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit 9/22/2008 9/20/2008 9/22/2008 151451

Customer Information

City State Zip Contact **Business** First Name **Last Name** Street Age Type H 229-393-6508 198 Crabapple Dr Brinson Thomasville GA 31757 Incident Kerry E kb91760@live.com

Incident Information

Repair Est. Medical Treatment Medical Status Claims Codes

ΡI

PD Altered Adjustments or Components Cause:4006

S Fires on removing safety

Concern:1007 Fired on Safe Release

Unknown

9/23/08 gun accidentally discharged once by simply moving the safety selector in early 80's. Have rarely fired this gun since. Noticed our Safety Mod Program.cm

Firearm Information

Model/Ga. SKU Bbl. DOM Serial Mfg. Type 104536 BR 1/1/1968 Remington CF/BA 660/222 REM Accessories **Date Purchased** Where Purchased **Original Owner** HARD CASE U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/660/CF/BA

Reim. Date Cash Date Cash Release of Claims Release Date Reimbursement Settlement Settlement APV APV

replace TPA at no charge

> Repair/Replacement Repair/Replacement Date Cost 65.00 9/23/2008

9/23/08 Fred says trig screws altered. Trig assem not updated from recall. Replace TPA at no charge under recall.cm

Examination[Remington/CF/BA]

 
Sub-Part	Code	Comment
Examiner		B.TRAVIS
Exam Date]	9/22/2008
Product Type		RF
Action Type		A
Assigned To		F.SUPRY
4006	Altered Adjustments or Components	TPA HAS NOT BEEN UPDATED UNDER RECALL
Description		20" 222 REM
Date Code		BR
Bore Plugged	False	
Bulged	False	
Fired	False	
Fired while Obstructed		
	Examiner Exam Date Product Type Action Type Assigned To 4006 Description Date Code Bore Plugged Bulged Fired	Examiner Exam Date Product Type Action Type Assigned To 4006 Description Date Code Bore Plugged Bulged False Fired False False

0/00/0000

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/660 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.005
	Notch	Slightly Worn; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		HARD CASE

0/00/0000

pair Inquiry		11.
aii:Number: RE00151451 Serial::104538:Model (222:REM	DEO: Center Fire: Caliber, Repairman, Bluce Travis Status: Repairing 9/22/2008 6:05:06 AM	
ress Information Customer F Received Name: KERRY BRINSON	From Return To C Received From KERRY BRINSON	
ess 1 198 CRABAPPLE DR.	198 CRARAPPLE DR.	
ess 2: PO Box: THOMASVILLE State: GA Zip Code: 31757 Country: IUS	THOMASVILLE State: GA Zip Code: 31757 Country US	
State (Fig. 2)	SEEL FOR THE SEEL SEEL SEEL SEEL SEEL SEEL SEEL SE	
ontact / Condition Problems	Estimate	
	Current Status	
te	Desc2 Shipping Hold Repairing	
/19/2008 9:52:4 Update sangui Repair information change	Faircale Seal System	
/19/2008/9:54-1 Expedite sangui From: Check In /19/2008/12:05: EmailSen: ArmEn: Repair Received	To: Stimate Sent System KB91760@LIVE.COM	
/19/2008;12:05: EmailVerit; AmErr Receipt	Kegai Zoogy N.C. COM	
/22/2008/5/59/2 Expedite Travisl From Product Services	To: Repail Bench C Rejum As Received Current coation	
22/2008 6:01:4 Estimate Travisl Estimate Update 22/2008 6:05:0 Repairing System Immediate SAP Allocation	Status: PartsHold	
22/2000 b.t.o.c. [repearing System managine 3/4: Autocaton		
Company of the Compan		
Répair <u>S</u> earch	<u>R</u> efresh <u>C</u> lose	
and \$P\$ [4] (人名马尔克 克 (4) (人名德尔) "在我的事事的事的对方的,我们不是是一个一个一		







General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Serial Number: 104536 Model Number: 660 Name: kerry brinson Date of Purchase: mid 70's Address (no PO Boxes): 198 crabapple dr City: thomasville State: GA Zip: 31757 Phone (Daytime): 229-393-6508 Fax: E-mail Address: kb91760@live.com Please describe your problem: Gun accidently discharged once by simply moving the safety selector in early 80's. Have ralely fired this gun since. Noticed that you have a Safety Modification Program that could correct the problem. Please repair. TRIG. S CREWS BLYERED. Also, am interested in replacing the bottom plate. Please inform. Trig. ASSM. Not updated from recall.

replace TPA OT N/C under recall. Thanks, Kerry # 230145 199 characters left NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time. WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) Remove all accessories from your firearm to prevent loss or damage. Ship your ENSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.



Us

Other Sites

oneral_repair_form.asp

9/10/2008