

Remington Arms Co., Inc.
Product Service
Legal Case #:2832

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
154418	10/31/2008	11/3/2008	11/3/2008	10/18/2008			

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Estes	Barnett	617 Frontier Dr	Gillette	WY	82718		H 865-604-7827 E barnettsignaturecalls@yahoo.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Cause:4006 fired on safe release	Altered Adjustments or Components	Unknown	
C	Concern:1007	Fired on Safe Release		

Customer says he experienced an accidental discharge on 10/18/2008 while moving the safety lever from safe to unsafe.

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial Bbl.	DOM
Remington	CF/BA	722/244 REM	20000	386183	AD 3/1/1957
Date Purchased	Where Purchased	Accessories	Original Owner		
	B3STWICK BRAUN TOLEDO OHIO	HARD CASE, GUN SOCK	U		

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/722/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
BLM Program						

Repair/Replacement Cost	Repair/Replacement Date

11/3/2008 at examination we found the trigger set screw positions had been altered - an outside trigger pull screw installed. The barrel had been turned in the receiver. We are replacing the trigger assembly and cleaning the action under the bolt lock modification program fls.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/3/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY

Cause	4006	Altered Adjustments or Components	
Barrel	Description		26" 244 REM
	Date Code		AD
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Worn; Functioning	BBL TURNED IN REC
	Stock Condition	Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/722 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.012
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	2#
	Altered	True	SET SCREWS ALTERED OUTSIDE T.P. SCREW INSTALLED
	Sub-Assembly	Non-Remington	
Non-Remington Components	Description		HARD CASE, GUN SOCK

Address Information

FILE						
------	--	--	--	--	--	--

Repair Search

Refresh

Close

2832


 3D 3/57
 2#
 26"
 .012

General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: <input type="text" value="Model 722"/>	Serial Number: <input type="text" value="386183"/>
Name: <input type="text" value="Estes Barnett"/>	Date of Purchase: <input type="text" value="June 2008"/>
Address (no PO Boxes): <input type="text" value="617 Frontier Dr"/>	
City: <input type="text" value="Gillette"/>	State: <input type="text" value="WY"/> Zip: <input type="text" value="82718"/>
Phone (Daytime): <input type="text" value="865-604-7827"/>	Fax: <input type="text"/>
E-mail Address: <input type="text" value="barnettsignaturecalls@yahoo.com"/>	
<p>Please describe your problem:</p> <p>Accidental discharge on Oct 18, 2008 while moving the safety lever from safe to unsafe. Please evaluate this rifle for an updated safety. If new safety installation is advised, please install the new type safety. I contacted the repair center on Monday Oct 20, 2008 for instructions.</p> <p><i>Estes Barnett</i> Estes Barnett</p> <p>10/22/08</p>	
193 characters left	
<p>NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.</p> <p>⚠ WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.</p> <p>Record the serial number of your firearm before sending it. Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a</p>	
<p>damage. Remington is not responsible for damage or loss in your carrier.</p>	

386183

Model: 722



RE00154418

About Us

Other Sites

Trig. Set screws altered. HAS
 AN outside Trig. pull screen installed
 BRL. HAS BEEN TURNED IN FOR
 REPLACE TPA, check over, clean
 UNDER BOLT LOCK PROGRAM ROR
 \$ 20.00

Quote 10/22/08

719

DATE 5-27-68

Estes Barnett

ADDRESS

THANK YOU!

SIGNATURE

REVISED
F 32072-40 bks-6/08