PrintDisplay Page 1 of 2

> Remington Arms Co., Inc. Product Service Legal Case #:4656

Case Information

RE# Date Opened Date Opened(PS) **Date Closed Incident Date** Pre Lit Obsolete Lit 199797 8/3/2010 8/3/2010 8/5/2010

Customer Information

Type **Business** First Name Last Name Street City State Zip Age Contact W 303-350-6775 4431 Mesa Verde Dr. CO Reporter James Armstrong Greeley 80634 C 970-443-2131

Incident Information

Claims Codes Repair Est. **Medical Treatment** Medical Status

ΡI PD

S FSR

Cause: 4006 Altered Adjustments or Components

Unknown Concern:1007 Fired on Safe Release

Did not duplicate the FSR concern but, did get the firing pin to release closing the bolt extremely hard. fls

Firearm Information

SKU Model/Ga. Bbl. DOM Mfg. Type Serial 700/2506 CZ CF/BA n/a 6849207 4/1/1975 Remington Date Purchased Where Purchased Accessories Original Owner

BERNS WHLS DENVER COLORADO U

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Reim. Date Cash Date Cash Release of Claims Release Date Reimbursement Settlement Settlement APV APV

Quoting for Bolt Lock Modification


> Repair/Replacement Repair/Replacement Date Cost 8/5/2010 \$60.23

Quoting bolt lock modification. fls

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment				
Examination	Examiner		supry				
	Exam Date		8/3/2010				
	Product Type		RF				
	Action Type		A				
	Assigned To		Supry				
Cause	4006		As received the trigger pull was below factory specifications. Trigger screw backed out so far that the trigger would not reliably return under the sear.				
	Description		22 inch 2506				
	Date Code		CZ				
	Bore Plugged	False	· · · · · ·				
	Bulged	False					
	Fired	False					
	Fired while Obstructed						
	Muzzle/Crown	Slightly Worn;					

	Condition	Functioning		
	Firing Pin	Worn; Functioning	Ī	
Bolt  Handle  Stop  Condition  Extractor  Cut Condition  Ext/Eject Test		Worn; Functioning	Ī	
	Face	Slightly Worn; Functioning		
	Slightly Worn; Functioning			
	Stop	Slightly Worn; Functioning		
	Condition	Slightly Worn; Functioning		
		Slightly Worn; Functioning		
	Ext/Eject Test	True		
	Block Condition	Select		
Locking	Lug Condition	Slightly Worn; Functioning		
	Notch Condition	Select		
	Condition	Select	] .	
Magazine	Box Condition	Slightly Worn; Functioning		
	Exterior Condition	Worn; Functioning		
Overall	Stock Condition	Worn; Functioning		
	Fore End Condition	Select	]	
Receiver	Condition	Slightly Worn; Functioning		
	Bulged	True	I	
	Description	]	Model 700 Bolt Lock	
Safety	Function	Abused; Functioning	]	
	Sub-Assembly	Non-ISS		
	Lift	Select	not measured	 
Sear	Notch	Slightly Worn; Functioning		
		Condition	Abused; Functioning	
Pull		Select	2.25 lbs	
Altered	Trigger	True	]	
Sub- Assembly		M/700 Bolt Lock		

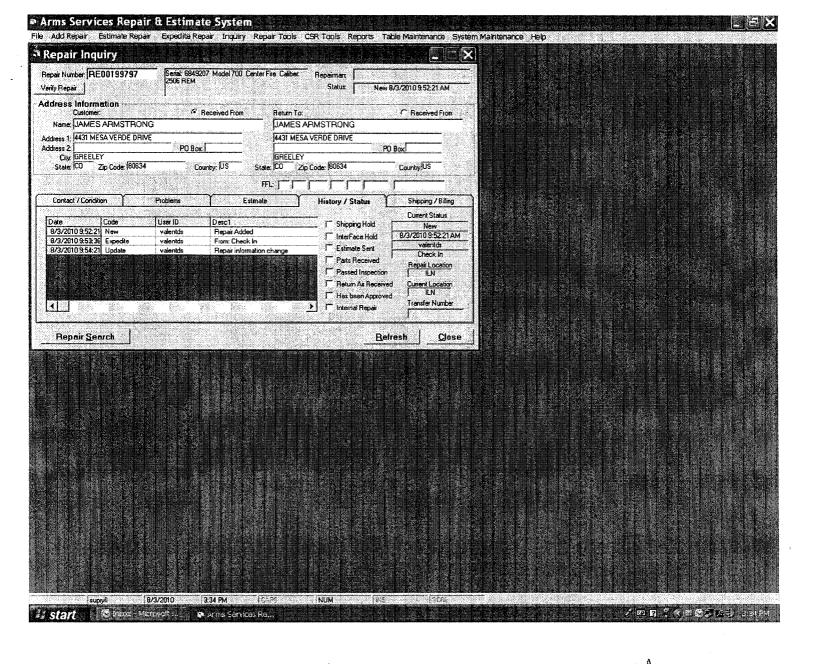

Albert Trigger screws. the

TECETVET trigger is loose screw not

AUG-42010 tight enough to return trigger

BY:

under sear reliabily.

4056

JAMES ARMSTRONG 4431 MESA VERDE DR. GREELEY, CO 80634

cel:970-443-2131

Wk: 303-350-6775

**6849207** 

Model: 700

When Gun is loaded and a shell chambered, the gun will actually fire the round when you take the safety off. It does not do it every time but I have been able to re-create the issue after multiple attempts. Please contact me with any questions.

Sincerely James Armstrong

Thank you In advance

Quote for both lock modification TRED 8/3/10

## 6849207

Model: 700



RE00199797

