.

1

				Remington A Product Legal Ca	Service							
Case Infor	mation											
RE#	Date	Opened	Date Opened(PS) Date Cl		te Closed	sed Incident Date		ate	Pre Li	t]	Lit	Obsolete
242746	10/6	5/2011	10/7/201	1 1	0/7/2011	2011 9/25/2011		1				
Customer	Information											
Туре	Business	First Name	Last Name	Street	City	State	Zip	Age		Co	ntact	
Incident		Scott	Brashears	012 N. 600 East	Fairfield	ID	83327				720-03 om@ya	32 hoo.com
Incident Ir	formation								-			
	Cla	ims		Codes	;		Repair 1	Est. Me	dical Tre	atme	ent Me	dical Statu
PI												
PD			Cause:	4038 Could Not	Duplicate C	oncern						
S				n:1007 Fired on S	•	oncern			Unknov	vn		
C Unexp		harge when set										
stated the	rifle went of	ff 9/25/11 when	n safety was mo	of 2010, the rifle ved to off position.	He wants a	new trig	ger insta	lled. Nee	eds rifle b	ack a	isap for	hunting. di
	nformation		Tuno		Model/	2 a	\$	KU	Sei	rial	Bbl.	DOM
Remi	fg.		Турс С F/ ВА		700/3006 \$		-	n/a)273	DDI. DZ	9/22/1975
	rchased		Where Purchas	ed	Accesso	_		al Owne			22	
		FANNING	WHLSE IDAH	O FALLS ID				U				
CONCER	N:WENT O	FF BY ITSEL	F, FSR									
Ammuniti	ion Informat	ion - None Del	ined									
Other Proc	ducts Inform	nation - None I	Defined									
Settlement	t											
				Remington	700/CF/BA							
Set	ttlement	Releas	e of Claims	Release D	ate	Reimbu	rsement		ash ement		n. Date PV	Cash Dat APV
	on - Quote to under BLM											
		Repair/	Replacement Cost	Repair/Repla Date	cement							
		9	33.8 6	10/18/20	11							
				A set screws altere quote. Customer a				ly. Mag	box out c	of pos	ition w	hen

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		10/7/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		22" 3006 SPRG
	Date Code		DZ
Barrel	Bore Plugged	False	
Banci	Bulged	False	
	Fired	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6651&Type=Case

10/18/2011

,

,

4

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
L	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.007
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
	Condition	Slightly Worn; Functioning	TRIG NOT RETURNING PROPERLY
Trigger	Pull	Select	3#
TITEEM	Altered	Тгие	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

60						
Model Number: 700 BPL 30-06 LH	Serial Number: 68 60 27 3					
Name: Scett BRASHEARS	Date of Purchase:					
Address (no PO Boxes): DI2 N. 600 FAST						
City: FAiRFiely	State: IV.	Zip: 83327				
Phone (Daytime): 208-720-033 2	Fax:					
E-mail Address: Scott M	Zoom@YAH	sc. com				
Please describe y						
FALL of 2010 - Rifle went off BY it's SELT WHEN SET POWN. HAPRIFLE & ONE +HROUGH BY JUNSMITH						
Rifle went off 9-25-2011	WHEN SAATY	WAS MOVED				
to "Off" Position. PLEASE REPLACE WALKER TRIZZER Wint A NEW PACTORY TRIZZER ASSEMBLY, WHICH POES Not INCORPORTE A DOLT - LOOK MECHANISM. XMARK PRO TRIZZER SYSTEM. NEED RITE BACK ASAP FOR HUNTING THANKS!!! 500 characters left						
NOTE: Prior to shipping your firearm, co provided and estima	ntact the Repair C					
WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.						
:: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.						
(Print.)	[Reset;])				

22" DZ9/75 3¹



could not duplicate concern T.A. set screws Altered, Timq. Not repurning properly. MAG. Box out of position when sec'D. Apply-ce TPA, c EART TOST Rire Under BCP RONX 2000+ Ship DECENVED OCT 132011

BY:_____

۲.

http://www.remington.com/asp/general_repair_form.asp

9/26/2011

PS 22853









