

Remington Arms Co., Inc.
Product Service
Legal Case #:6896

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
247751	11/22/2011	11/23/2011	11/23/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Chris	Hite	9609 Hwy 49	Roxboro	NC	27574		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Fired on safety release Concern:1007 Fired on Safe Release			
C				

12/8/11 Per note with rifle, gun fires when safe is clicked off.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/300 RUM	26096	E6735398	CV	4/16/2001 6:31:12 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	ELLETT BROTHERS	SCOPE BASE	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire at 1/2 normal cost						
Repair/Replacement Cost	Repair/Replacement Date					

12/8/11 Per Ilion, trigger assm dirty and rusty. Trigger and trigger pin rusted causing trigger to bind. Replace TPA, clean and test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/23/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		26" 300 RUM
	Date Code		CV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,TRIGGER RUSTED,BINDING
	Pull	---Select---	10+#
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

⁶⁸⁹⁸
Chris Hite
9609 Hwy 49
Roxboro NC 27574

26"
CV 4/10
10+1

Remington 700 300ultra mag
Ser# E6735398

Gun Fires when Safe
is clicked off
New Trigger Repair

Serial Number:
E6735398

Model: 700



RE00247751

RECEIVED
NOV 29 2011

BY: _____

T.A. dirty + rusty. Trig. + Trig. pin rusted
causing trig. to bind. Replace TRIG. CAW
& test fire at 1/2 normal cost.

Quote

E6735398

Model 700



RE00247751





