Remington Arms Co., Inc. Product Service Legal Case #:7538

Case Information Date Opened(PS) RE# Date Opened Date Closed **Incident Date** Pre Lit Lit Obsolete 262957 3/28/2012 3/29/2012 3/29/2012 Customer Information Type **Business** First Name Last Name Street Contact City State Zip Age 607 King St. Reporter Hardens Inc. Hardens Inc. Newton 36352 E gharden@sw.rr.com Incident Information Medical Medical Repair Claims Codes Est. Treatment Status PΙ Altered Adjustments or PD Cause:4006 Components Failed a 2" drop test after setting TA Unknown S Jar-Off - No Mention of Safety Concern:1026 Position C SR# 14933 - Reason for Return: Check trigger pull, Service Request Section: Gunsmith stated that he did a 2" drop test after setting trigger at 3 lbs & trigger drops. df Firearm Information Mfg. Model/Ga. SKU Rbl. DOM Type Serial Remington CF/BA 700/7MM RUM 27315 S6770428 OF 7/13/2011 12:46:39 PM **Date Purchased** Where Purchased Accessories Original Owner JERRY S SPORTS INC. U CONCERN: TRIGGER DROPS WHEN PULL SET AT 3# Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/CF/BA Reim. Date Cash Date Cash Settlement Release of Claims Release Date Reimbursement Settlement APV APV Per Ilion - Replace TA @ n/c - warranty Repair/Replacement Repair/Replacement Cost Date \$83 4/9/12: Per Ilion - Trigger assembly pull screw altered. Could not duplicate concern. As a goodwill gesture to restore confidence in rifle - will replace TA, check over & test @ n/c - warranty. df Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		3/29/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
	4006	Altered Adjustments or Components	MAG BOX WAS MISASSM WHEN REC'D ALSO
	Description		26" 7MM RUM FL HB SS
	Date Code		OF
	Bore Plugged	False	
	Bulged	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7538&Type=Case

4/24/2012

	Fired	False	
Barrel	Fired while Obstructed		
	Muzzle/Crown Condition	Like new; Functioning	
Bolt	Firing Pin	Like new; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Like new; Functioning	
	Stop	Like new; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
ocking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Like new; Not Functioning	
Overall	Stock Condition	Like new; Functioning	
	Fore End Condition	Select	
2 anaiyar	Condition	Like new; Functioning	
Receiver	Bulged	False	
	Description]	XMP SAFETY
Safety	Function	Like new; Functioning	
L	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.011
	Notch	Like new; Functioning	
		Test Fired	False
Feeding Fest	Tests	False	
Trigger	Condition	Like new; Not Functioning	MIN TRIG RETURN
	Pull	Select	3#
	Altered	Тпие	TRIGGER PULL SCREW WAS ADJUSTED BEYOND THE LIMIT, ADJUSTING SCREW WAS NOT
	Sub-Assembly	X-Mark Pro	

Service Request

Remington Service PO Box 700



Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the ser information will serve as a guideline for our Service Department to address your specific concerns and provide you with RETAIN THIS COPY FOR YOUR RECORDS.

	0F7
vices you are requesting are noted. This	0

Service Request Number	Serial Number / Descr	iption			Date o	f Request:	03/12/2012	
SR00014933	S677042S		A		Date	Printed:	03/12/2012	1
Customer: HARDEN'S INC 607 KING ST NEWTON, AL 36352	Model 700 RIFLE		Des	stination: Arms Services 14 Hoefler Ave Ilion, NY 13357	us			
Email: gharden@sw.rr.co	m			Email:				
-Your request for service on th	e item(s) will be evaluated			ed under our warranty	policy. I	Eit is your fir	earn will be	
repaired and returned. If not,	you will be confacted with	a an estimate before we	ork is performed.	د				.
•	•							
			• •					
				•				
	Cartaina Service Control	Sales and the second	a a company and the second		en laterary	S12 # 8 5 3 1 5 0	Managaran da	377663
Reason For Return				10.0		4. 1.7		4
M510 - CHECK TRIGGE	R PULL	The Marches of the Arms South South States and Arms South States a	The same of the sa	AND THE PROPERTY OF THE PROPER	CONTRACTOR OF THE PARTY OF THE	Control of the Contro	All the second of the second o	
							•	
Service Request Section					¥44.0			
Gunsmith stated that he did	a two inch buit drop test	after setting trigger at	3 pounds and trigge	* W/B	o H	FAST	Close	000
drops.		1			•	, , ,		
Need	Trip	Set +	311.	Than			·	
Parte And Service Details Material Type	Description		Qiv Needed	Warranty		Price	Disc Amo	unt .

S6770428 Model: 700

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Could Not duplicate concern.

As A Good-will Gest use to justone confidence in rifle will will replace TPA, chechoven + trest AT N/C WARRANT

Sub Total: Est Sales Tax:

.00 -- 60

Grand Total:

5.00

APR 0.9 2012

BY:____





