

Remington Arms Co., Inc.
Product Service
Legal Case #:8251

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
290895	11/30/2012	12/3/2012	12/3/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Chuck	Tomlinson	138 Broski Rd.	Broadalbin	NY	12025		H 518-883-5427 E chuckster2@nycap.rr.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S FSR	Concern:1007 Fired on Safe Release			
C				

SR# 35383 - Per customer: Fires when safety is taken off. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	7/308 WIN	24788	7634269	DE	9/1/1984
Date Purchased	Where Purchased	Accessories	Original Owner			
	RESSUS SPTG GDS CO INC 12207		U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair @ 1/2 normal cost						
	Repair/Replacement Cost	Repair/Replacement Date				

12/5/12: Per Ilion - Trigger pin rusty & binding trigger. Replace TA, clean & test @ 1/2 normal cost - quote. Customer apprvd & paid quote on 12/4. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/3/2012
	Product Type		RF
	Action Type		A
	Assigned To		J.BALJO
Cause	4015	Improper Maintenance	
Barrel	Description		18.5" 308 WIN
	Date Code		DE
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG PIN RUSTY, TRIG BINDS PIN ALSO OUT OF POSITION
	Pull	---Select---	8.5#
	Altered	False	
	Sub-Assembly	Other Remington	

www.Remington.com

18.5"
DZ 9/8,
8.5±

Date of Request: 11/16/2012
Date Printed: 11/16/2012

Destination:
Arms Services
14 Hoefler Ave
Ilion, NY 13357 US

Email: chuckster2@nycap.rr.com

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

M310 - PERFORM SAFETY CHECKS ON TRIGGER ASSEMBLY

Service Request Section
fires when safety is taken off

11/28/12

Dear Sirs;

I have misplaced my bill of Sale.
I purchased my model 7 from Bleeker
Sports. Bleeker Stage, Gloversville
Ny 12078. (around 1988)
Any Questions please call me
(518) 883-5427 Thank you

Urantia

Price	Disc	Amount
-------	------	--------

Charles R Tomlinson

RECEIVED
DEC 05 2012

BY:.....

Number: 7634269

Model: SEVEN



RE00290895

Triq. pin Rusty + Binding
Triq. by TPA, Clean & Test
at 1/2 normal cost.

Q

Sub Total:	.00
Est Sales Tax:	.00
Grand Total:	\$.00





