## Remington Arms Co., Inc. Product Service Legal Case #:7650

Case	Intorma	tion

**Incident Date** Obsolete RE# Date Opened Date Opened(PS) Date Closed Pre Lit Lit 5/25/2012 5/8/2012 5/29/2012 268913

Customer Information

**Business** Last Name Street City Zip Contact Type First Name State Age 110 Gladiola 75693 H 903-720-3359 Incident Dylan Anderson White Oak TX

Incident Information

Repair Est. Medical Treatment Medical Status Claims Codes

ΡI

PD

Cause: 4006 Altered Adjustments or Components

Fired when releasing S safety

Concern: 1007 Fired on Safe Release

Unknown

C

5/8/12 Per call from Anderson, this weekend he took his 700 out and it fired when he took the safety off. It has always had a light trigger pull since he bought it new. He bought it from a dealer who special ordered it for another customer. The dealer sighted it in, the customer took it out but did not like it. The dealer then sold it to Anderson.cm

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 700/270 WIN SKU n/a

Serial Bbl. F6238421Z RW

DOM 1/10/2003 6:18:53 AM

Date Purchased Where Purchased Accessories **Original Owner** 

EDGAR BROTHERS

SCOPE BASE

N

CONCERN: FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Date Cash Date APV APV

Per Ilion, replace TPA, clean, test at 1/2 normal cost

Repair/Replacement Cost

Repair/Replacement Date

5/8/12 Mailing ARS.cm 5/31/12 Per Ilion, trigger assm dirty, sticky, rusty and set screws altered. Replace TPA, clean, test at 1/2 normal cost.cm


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
Examination	Exam Date		5/29/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	IMPROPER MAINTENANCE
ВатеІ	Description		22" 270 WIN
	Date Code		RW
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7650&Type=Case

5/31/2012

H			_
	Fired while Obstructed		<b>_</b>
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	<u> </u>
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	METAL RUSTY, DIRTY
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	ISS	] ·
	Lift	Select	.013
Sear	Notch	Slightly Worn; Functioning	
	Tank	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY,RUSTY WILL FOLLOW DOWN
	Pull	Select	1.5#
	Altered	True	SET SCREWS ALTERED
Non-Remington Components	Description		SCOPE BASE

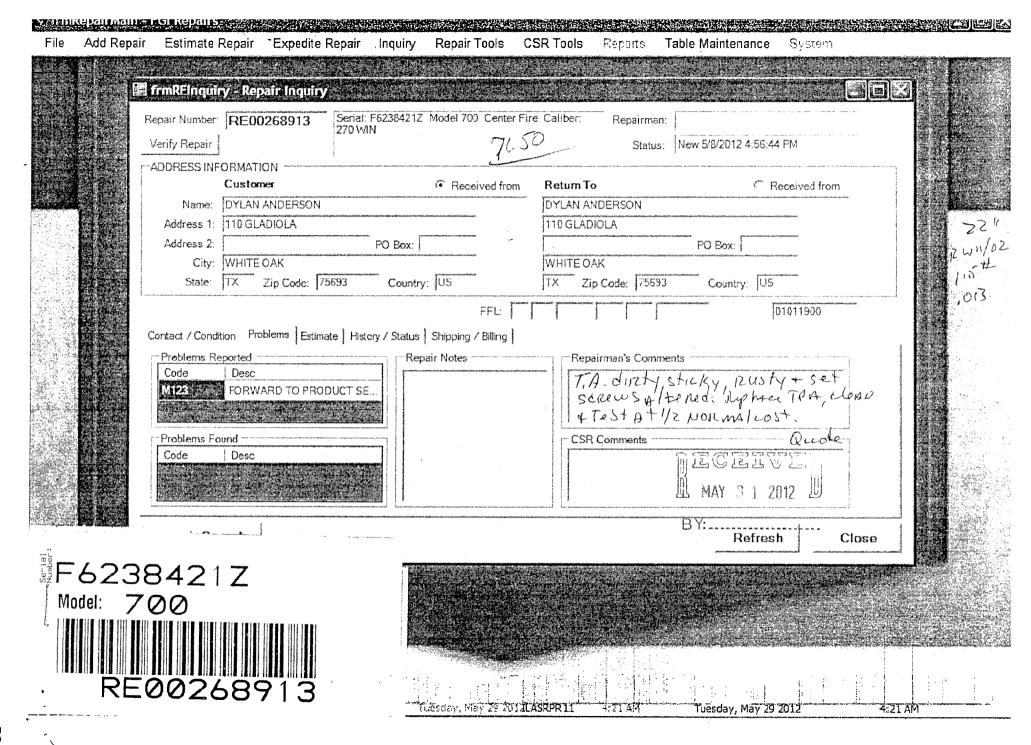

## ARS LABEL REQUEST FORM

DATE:	05/08/2012	Service Request #	SR00019553
QUANTITY:	1 ·	WEIGHT PER PACKAGE:	10 LBS
REQUESTED BY:	mitchellcs	email address:	Christy.Mitchell@remington.com
:			
·	•		
·			

**Business:** 

Remington Service PO Box 700 Madison, NC 27025-0700 www.Remington.com

## LABEL INFORMATION

DYLAN ANDERSON 110 GLADIOLA WHITE OAK, TX 75693 US SR00019553

Email: Christy

**RETURN ITEM TO:** 

ILN

Arms Services

## 

4XX596 MAY 9, 2012 ALL CURR USD SYC GNDCOM ACT WT 10.0 LBS IRACKING# 1Z4XX5969067715909 1 OF 1 REF 1:SR00019553 REF 2:

ATTN: Prod Serv #7650

HANDLING CHARGE 0.00 SVC T/P USD RS 0.50 SINGLE-PIECE PUB RATE CHRGS: COD 0.00 DV 0.00 DC 0.00 SD 0.00 DCD 0.00 SP 0.00 0.00 PR AH 0.00 10.93 PUB+HANDLING TOT PUB CHG 10.93





