Remington Arms Co., Inc. Product Service Legal Case #:7549

Case Information

RE# Date Opened 3/30/2012

Date Opened(PS) 4/2/2012

**Date Closed** 4/2/2012

**Incident Date** 

Pre Lit Lit Obsolete

263592 Customer Information

Type

Business First Name Street

City State Zip Age

Contact W 432-335-5750

Reporter Odessa Police Department

Odessa Police D 205 N. Grant Odessa TX 79761

C 432-238-6085 E cchavez@odessa.tx.gov

Incident Information

Claims

Codes

Last Name

Repair Est. Medical Treatment Medical Status

PΙ

PD

Cause: 4038 Could Not Duplicate Concern

S Unexplained Discharge Concern: 1006 Unexplained Discharge Safe OFF

Unknown

Agency sent rifle in w/note. Sgt Carlos Chavez reported that a sniper was on the range and the rifle did not fire, when he touched the bolt, the rifle fired. No report of damage or injury. df

Firearm Information

Mfg.

Type

Model/Ga.

SKU 27496

Rhl. Serial E6344163

DOM

Remington

CF/BA

700/308 WIN

U

1/21/1997

Date Purchased

Where Purchased

Release of Claims

Accessories AFT MKT-STK,BIPOD,BBL Original Owner

ELLETT BROTHERS CONCERN:FIRED WHILE LIFTING BOLT

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Release Date

Reimbursement

Cash Settlement

Reim. Date Cash Date

APV APV

Settlement Per Ilion - Quote to

repair

## Repair/Replacement Cost Repair/Replacement Date

4/9/12: Per Ilion - Could not duplicate concern at bench. TA dirty & set screws altered. Can offer to replace TA, clean & check over at 1/2 normal cost - quote. Agency paid quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
Examination	Exam Date		4/2/2012
	Product Type	]	RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
ВаттеІ	Description		NOT OUR MFG
	Date Code		
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		_
	Muzzle/Crown Condition	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7549&Type=Case

4/18/2012

	<del> </del>		:
	Firing Pin	Slightly Worn; Functioning	
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Not Functioning	BINDS
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	·
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	*Non-Standard	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.015
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	lests	False	
	Condition	Slightly Worn; Functioning	DIRTY, WORN AT STRIKER ENGAGEMENT
Tui accon	Pull	Select	3.5#
Trigger	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		AFT MKT-STK,BIPOD,BBL

## Service Request

## Remington Service PO Box 700



03/26/2012

03/26/2012

Date of Request:

Printed:

2411

3,5#

Medison, NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

Service Request Number | Serial Number | Description

SR00016074 E6344163

Model 700 RIFLE

Customer: ODESSA POLICE DEPARTMENT

205 N GRANT

ODESSA, TX 79761 US

Destination:

Arms Services 14 Hoefler Ave

Ilion, NY 13357 US

Email: CCHAVEZ@ODESSA-TX.GOV

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M100 - SEE CUSTOMERS LETTER

Service Request Section: FIRES WHEN BOLT IS CLOSED.

Type

Material

**鷺E6344163** 



APR 0 9 2012

Could not diplicate At Rench.

T. A dinty + set screws a Heard,

CAN office to replace TDB clear

+ check over At 1/2 Normal cost,

Sub Total: Est Sales Tax: .00 .00

Grand Total:

<u>\$.</u>00

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the



Police Department

205 N. Grant

Odessa, Texas 79761

Date: 03/28/12

To Whom It May Concern:

One of our snipers went to shoot his cold bore shot. He loaded the rifle and closed the bolt, as normal. The rifle engaged and the indicator was in position as normal. The sniper squeezed the trigger and there was a slight "click" but it was definitely not the sound of a dry fire. As the sniper raised off of his scope to see what had happen he observed the safety was in the fire position and the bolt was still engaged. The sniper stated he grabbed the bolt handle and the rifle fired. There was nothing on the trigger that could have caused this to occur. The ejected casing did not have any deformities, nor did it appear to have been double tapped. Myself and the snipers have seen the online documents and videos of the Remington 700 rifle having similar problems. Could you also make sure the trigger is at 3.5 pounds? Thank you.

Sincerely,

Carlos Chavez, Sergeant (Range Master)

Odessa Police Department

205 N. Grant

Odessa, Tx. 79761

(432)-335-5750 Office

(432)-238-6085 Cell

Telephone: 432-333-3641

FAX: 432-335-3383







