

Remington Arms Co., Inc.
Product Service
Legal Case #:7405

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
258713	2/15/2012	2/16/2012	2/16/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Simmons Sporting Goods	Simmons Sportin	2001 2nd Ave, North	Bessemer	AL	35020			

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Fired on closing bolt, safety movement	Cause:4006 Altered Adjustments or Components	Unknown	
C	Concern:1008 Fired on Bolt Closing			

2/29/12 Per letter with rifle, if the rifle barrel is in a horizontal position and the rifle is tilted clockwise right more than 90 degrees while closing the bolt the rifle often fires without the trigger being touched. If the rifle barrel is in that same position and the safety is moved from S to F the rifle often fires without the trigger being touched.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/223 REM	26187	S6488842	AY	3/29/2004 7:22:44 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	SPORTS SOUTH INC		U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion,replace TPA, clean, test fire at 1/2 normal cost						
Repair/Replacement Cost	Repair/Replacement Date					

2/29/12 Per Ilion, trigger assm set screws altered, trigger not returning. Replace TPA, clean, test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/16/2012
	Product Type		RF
	Action Type		A

<http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7405&Type=Case>

2/29/2012

	Assigned To	T.NAGLE	
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 223 REM SS FL
	Date Code		AY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	
	Condition -	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	--Select--	
	Lug Condition	Slightly Worn; Functioning	
Overall	Notch Condition	--Select--	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
Receiver	Fore End Condition	--Select--	
	Condition	Slightly Worn; Functioning	
Safety	Bulged	False	
	Description		M/700 SAFETY
	Function	Like new; Functioning	
Sear	Sub-Assembly	ISS	
	Lift	--Select--	.011
	Notch	Slightly Worn; Functioning	
Feeding Test	Test Fired	False	
	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	--Select--	1.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

7405
Simmons Sporting Goods

2001 2nd Avenue, North

Bessemer, AL 35020

205 425-4720

*22" ~~REM~~
AY 3/01
1.5"
1011*

Serial
Number:

S6488842

Model: 700



RE00258713

February 9, 2012

Re: Remington Model 700, Cal 223 REM, Stainless 22" Fluted
Barrel, Dark Gray Synthetic Stock, Serial Number S6488842

If the rifle barrel is in a horizontal position and the rifle is tilted clockwise (right) more than 90° while closing the bolt, the rifle often fires without the trigger being touched. If the rifle barrel is in a horizontal position and the rifle is tilted clockwise (right) more than 90° and the safety is moved from "S" to "F", the rifle often fires without the trigger being touched.

*T.A. set screws altered, trig,
NOT RETURNING. replace TPA,
clean + test fire at 1/2 normal
load.*

Quote

Repair # 3095

*Thanks
Russell Buckle*

RECEIVED
FEB 20 2012

BY:.....



156455542
Rev. 700
REG0255713



