

Remington Arms Co., Inc.
Product Service
Legal Case #:8128

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
288463/461/465/460	11/7/2012	11/8/2012	11/8/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		Chuck	Yeargain	5925 Cypress Point Dr.	Fort Worth	TX	76132		H 817-263-9929 F 817-263-9955 E cwyyear@swbell.net

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S FBC	Concern:1008 Fired on Bolt Closing			
C				

Customer sent in 4 rifles. He stated each one Fired on Bolt Closing. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/6MM REM	n/a	6347820	PT	6/1/1970
Date Purchased	Where Purchased	Accessories	Original Owner			
	PEDEN IND HOUSTON TX		U			

CONCERN: FBC

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	n/a	B6323490	PB	6/16/1981
Date Purchased	Where Purchased	Accessories	Original Owner			
	SOUTHERN GUN OPA LOCKA FL		U			

CONCERN: FBC

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6258474	OS	7/1/1969
Date Purchased	Where Purchased	Accessories	Original Owner			
	WEST TEX WHLSE ABILENE TEX		U			

CONCERN: FBC

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/300 WIN MA	n/a	A6219789	RZ	11/6/1975
Date Purchased	Where Purchased	Accessories	Original Owner			
	SPORTS SOUTH LAKE CHARLES LA	AFT MKT DM SYSTEM	U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$116					

11/13/12: Per Ilion - TA dirty, sticky & set screws altered. Trigger not returning properly. Replace TA, clean & test under BLM - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/8/2012
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 6MM REM
	Date Code		PT
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Test Fired	False	
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, STICKY TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
------	----------	------	---------

Examination	Examiner	B.TRAVIS	
	Exam Date	11/8/2012	
	Product Type	RF	
	Action Type	A	
	Assigned To	J.BALIO	
Cause	4038	Could Not Duplicate Concern	
Barrel	Description	22" 308 WIN	
	Date Code	PB	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	BOLT LOCK SAFETY	
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.011
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY, STICKY WITH A DRIED LUBE RESIDUE
	Pull	---Select---	3.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/8/2012
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4038	Could Not Duplicate Concern	
	Description		22" 3006 SPRG
	Date Code		OS
	Bore Plugged	False	

Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	ACTION DIRTY UNDER STOCK
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,LITE RUSTING
	Pull	---Select---	5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/8/2012
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 300 WIN MAG
	Date Code		RZ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	

	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,TRIG NOT RETURNING PROPERLY,WILL FOLLOW DOWN
	Pull	---Select---	3.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		AFT MKT DM SYSTEM

Model Number: 700 - 6mm		Serial Number: 6347820	
Name: Chuck Yeargain		Date of Purchase: Pre-1982	
Address (no PO Boxes): 5925 Cypress Point Drive			
City: Fort Worth		State: TX	Zip: 76132
Phone (Daytime): 817-263-9929		Fax: 817-263-9955	
E-mail Address: cwyear@swbell.net			
Please describe your problem: Firearm fired while cycling the action (unloaded dry-fire, no hand/finger near the trigger) multiple times when re-seating the bolt back into its proper forward and down position. The problem is inconsistent but very concerning. Have also experienced delay fire, again inconsistent but still very concerning. <i>T.A. dirty + sticky + part set screws w/te red. TPA not set properly. Rephone TPA, clean test under SCP ROR B20. + @</i>			
190 characters left			

RECEIVED
 NOV 13 2012

n, contact the Repair Center for
 air time.

OR SPENT SHELLS IN YOUR BY: _____
 WITH THE FIREARM. THIS IS A
 YOU FEEL YOU MUST SEND
 ITEM IN A SEPARATE PACKAGE AND
 ZIP CODE), TELEPHONE AND
 YOUR FIREARM.

:: Record the serial number of your firearm before sending it.
 :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
 :: Remove all accessories from your firearm to prevent loss or damage.
 :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

22"
 PTG/71
 2.5#
 .007

Serial Number:

6347820

Model: 700



RE00288463

Model Number: 700 - 308 win	Serial Number: 86323490	
Name: Chuck Yeargain	Date of Purchase: Pre-1982	
Address (no PO Boxes): 5925 Cypress Point Drive		
City: Fort Worth	State: TX	Zip: 76132
Phone (Daytime): 817-263-9929	Fax: 817-263-9955	
E-mail Address: cwyear@swbell.net		
Please describe your problem: Firearm fired while cycling the action (unloaded dry-fire, no hand/finger near the trigger) multiple times when re-seating the bolt back into its proper forward and down position. The problem is inconsistent but very concerning. Have also experienced delay fire, again inconsistent but still very concerning. <i>could not dup. concern</i> <i>T.H. has partially dried + sticky lube residue. replace TPA, clean + test under dup</i> <i>Con 820. +</i>		

190 characters left

n, contact the Repair Center for
air time.

OR SPENT SHELLS IN YOUR
WITH THE FIREARM. THIS IS A
YOU FEEL YOU MUST SEND
ITEM IN A SEPARATE PACKAGE AND
ZIP CODE), TELEPHONE AND
YOUR FIREARM.

- :: Record the serial number of your firearm before sending it.
- :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- :: Remove all accessories from your firearm to prevent loss or damage.
- :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

Serial Number:

B6323490

Model: 700



RE00288461

2211
057/69
5#
008

Model Number: 700 - 30-06		Serial Number: 6258474	
Name: Chuck Yeargain		Date of Purchase: Pre-1982	
Address (no PO Boxes): 5925 Cypress Point Drive			
City: Fort Worth		State: TX	Zip: 76132
Phone (Daytime): 817-263-9929		Fax: 817-263-9955	
E-mail Address: cwyear@swbell.net			
Please describe your problem: Firearm fired while cycling the action (unloaded dry-fire, no hand/finger near the trigger) multiple times when re-seating the bolt back into its proper forward and down position. The problem is inconsistent but very concerning. Have also experienced delay fire, again inconsistent but still very concerning. <i>could not dup. concern. T.A. dirty & some lite rusting. replaced TPA & cleaned & test under BCP Ron \$20 + Q</i>			
190 characters left			

Serial Number:

6258474

Model: 700



RE00288460

n, contact the Repair Center for
air time.

OR SPENT SHELLS IN YOUR
WITH THE FIREARM. THIS IS A
YOU FEEL YOU MUST SEND
ITEM IN A SEPARATE PACKAGE AND
ZIP CODE), TELEPHONE AND
YOUR FIREARM.

- :: Record the serial number of your firearm before sending it.
- :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- :: Remove all accessories from your firearm to prevent loss or damage.
- :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

Print

Reset

24"
22 11/75
3-5#
1007

Model Number: 700 - 300 win mag		Serial Number: A6219789	
Name: Chuck Yeargain		Date of Purchase: Pre-1982	
Address (no PO Boxes): 5925 Cypress Point Drive			
City: Fort Worth		State: TX	Zip: 76132
Phone (Daytime): 817-263-9929		Fax: 817-263-9955	
E-mail Address: cwyear@swbell.net			
Please describe your problem: Firearm fired while cycling the action (unloaded dry-fire, no hand/finger near the trigger) multiple times when re-seating the bolt back into its proper forward and down position. The problem is inconsistent but very concerning. Have also experienced delay fire, again inconsistent but still very concerning. <i>T.A. dirty & set screws altered trig. not returning properly. rep. TPA, clean + post under BLP for 810. + Q</i>			
190 characters left			

I, contact the Repair Center for air time.

OR SPENT SHELLS IN YOUR WITH THE FIREARM. THIS IS A YOU FEEL YOU MUST SEND EM IN A SEPARATE PACKAGE AND ZIP CODE), TELEPHONE AND YOUR FIREARM.

- .. Record the serial number of your firearm before sending it.
- :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- :: Remove all accessories from your firearm to prevent loss or damage.
- :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

Print

Reset

Serial Number:

A6219789

Model: 700



RE00288465

















