

Remington Arms Co., Inc.
Product Service
Legal Case #:9690

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
331046	12/16/2013	12/17/2013	12/17/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Barry	Broeckaert	7835 Cribbins Rd	Croswell	MI	48422		H 810-679-3733

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S FBC	Concern:1008	Fired on Bolt Closing	Unknown	
C				

Per note on SR00069750, "Problem: accidental discharge while unloading, fired when bolt was closed." jbi

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	N/A	6886894	OZ	7/16/1975

Date Purchased	Where Purchased	Accessories	Original Owner
	WILLIAMS GUNST DAVISON MICH		N

CPNCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
			Remington/700/CF/BA			

Per Ilion, quote
to repair BLM

Repair/Replacement Cost	Repair/Replacement Date
\$29	

12/19/13: Per Ilion, could not duplicate concern. Trigger assembly dirty, and some light rusting. Replace trigger assembly, check over, and test under BLP for \$20 plus shipping. jbi 12/30/13: Customer called in to Consumer Service and approved quote with a credit card. jbi

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment

Examination	Examiner	B.TRAVIS	
	Exam Date	12/17/2013	
	Product Type	RF	
	Action Type	A	
	Assigned To	S.NICHOLS	
Cause	4038	Could Not Duplicate Concern	
Barrel	Description	22" 3006 SPRG	
	Date Code	OZ	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	BOLT LOCK SAFETY	
	Function	Like new; Functioning	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,LITE RUST
	Pull	---Select---	5.5#
	Altered	False	SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	

Service Request

Remington Service

PO Box 700

Madison, NC 27025-0700

www.Remington.com

Parts and Repairs: P:800-243-9700/F:336-548-7801

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**



22
027
51
100

9690

Service Request Number SR00069750
Serial Number / Description 6886894
Model 77

Date of Request: 12/03/2013
Date Printed: 12/03/2013

Customer:
BARRY BROECKAERT
7835 CRIBBINS ROAD
CROSWELL, MI 48422 US

Email:

REMINGTON

Your request for service on the item(s) will be evaluated by our repairmen. If not, you will be contacted with an estimate before work is performed.

1. NO PROOF OF PURCHASE,
BOUGHT USED.

2. SER # 6886894

Reason For Return:
M240 - BOLT LOCK SAFETY MODIFICATION

3. PROBLEM; ACCIDENTAL DISCHARGE
WHILE UNLOADING, FIRED WHEN
BOLT WAS CLOSED.

Service Request Section:

Parts And Service Details:
Material **Type** **Description**

BARRY BROECKAERT
7835 CRIBBINS RD.
CROSWELL, MI
48422

RECEIVED
DEC 19 2013

BY:

PH. # 810-679-3733

Serial Number:

6886894

Model: 700



RE00331046

could not dup to cover
T.A. dirty + some like rusting.
Rep. T.A. check over + test
und. BCP for 20 +

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) being sent based on the conversation with our representative.

Sub Total: .00
Est Sales Tax: .00
Grand Total: \$.00







