PrintDisplay Page 1 of 2

> Remington Arms Co., Inc. Product Service

				Legal Case #:8	482							
Case Inf	Cormation											
RE# Date Opened		Date Opened(PS)		Date Cl	Date Closed In		ncident Date P		Pre Lit	Lit	Ol	osolete
29592	7 1/10/2013	1	/16/2013	1/16/2	013							
Customo	er Information											
Type	Business First Name	Last Name	Stre	eet	C	lity	State	Zip	Age		ontac	
Incident	Grant Grant	Buckley	1704 Frederica	Rd, Unit 223	Saint Sin	nons Island	GA	31522	E	H 912 gcb.62(1998 nail.com
Incident	Information											
	Claims		Codes		Rep	oair Est.	Medi	ical Tre	eatmen	t M	edica	l Status
PI												
PD		Cause:4015	Improper Main					Unknov	with			
S I	Delayed firing .	Concern: 102	3 Delayed Firing	g - Firearms				Cinaio	••••			
when his	Per note with rifle, on 2 is finger was not on the to it dry fired fine after ha	rigger and the	butt lightly hit h	nis lap. These s		ems later ha	ррепе	d when		ing. Yet		
Firearm	Information											
M	ifg. Ty	ре		Model/Ga.			SK	U	Sei	rial Bl	bi.	DOM
Rem	ington CF/	BA				RG 25793 B6833675 XG 12/18				/18/1986		
Date P	urchased Where P	urchased		Accessories	•	0	riginal	Owne	r			
	K MART EN	ITERPRISES	TWO PIECE I	BASE,BOTTO	M HALF I	RINGS	N					
CONCE	RN: DELAYED FIRIN	G										
Ammun	ition Information - Non	e Defined										
Other Pr	roducts Information - No	one Defined										
Settleme	ent											
			Re	mington/700/C	CF/BA							
								C	n lle	Daim		Cash
	Settlement	Rele	ase of Claims	Release	Date	Reimburs	ement		ish :ment	Reim Date A		Date
	on, can offer to replace T test fire at 1/2 normal c											APV
,			r/Replacement Cost	Repair/Repi								
	Per Ilion, trigger assm hest fire at 1/2 normal cos		ticky lubrication	residue causir	ng parts to	bind and w	ork slu	ggish. (Can off	er to rep	lace T	PA,
·	ation[Reminoton/CF/RA	·									•••	

Part	Sub-Part	Code	Comment	
	Examiner		B.TRAVIS	
	Exam Date		1/16/2013	\Box
Examination	Product Type		RF	
	Action Type		Α	
	Assigned To		J.BALIO	
Cause	4015	Improper Maintenance		
	Description		22" 3006 SPRG	
	Date Code		XG	
Barrel	Bore Plugged	False]	
Barter	Bulged	False		
	Fired	False		
,t				

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8482&Type=Case

1/21/2013

PrintDisplay Page 2 of 2

1	Fired while	I	
	Obstructed		
Muzzle/Crown Condition		Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	<u>=</u>
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
_	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description]	STANDARD SAFETY
Gurety	Function	Like new; Functioning	
	Lift	Select	.016
Sear	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired False	False
	Condition Slightly Worn; Not Functioning		DIRTY,STICKY PARTS BIND AND WORK SLUGGISH WILL FOLLOW DOWN
Trigger	Pull	Select	9#
	Altered	False	SEALANT PRESENT
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE, BOTTOM HALF RINGS

Model Number:
Remington 700

Name: Grant Buckley

Address (no PO Boxes):

1704 Frederica Rd., Unit 223

City: Saint Simons Island

Phone

Fax:

E-mail Address: gcb.62@hotmail.com

Please describe your problem:

Check trigger assembly. On 2 different hunts this weekend, the gun failed to fire when I pulled the trigger. It did fire after a 1-second delay, however. It even fired when my finger was not on the trigger and the butt lightly hit my lap. These same problems later happened when dry-firing. Yet, this morning, it dry-fired just fine after having been indoors all night. Sounds like the same problems reported online for last 2 years.

61 characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services ided and estimated repair time.

B6833675

RE00295927

(Daytime): 9122691998

VE OR SPENT SHELLS IN YOUR (WITH THE FIREARM. THIS IS A YOU FEEL YOU MUST SEND SPENT SEPARATE PACKAGE AND INCLUDE E), TELEPHONE AND MODEL AND OF YOUR FIREARM.

your firearm before sending it. ____rorevent further damage in shipping and

handling. Preferably, ship in a

firearm box. (Note: Original boxes may not be returned.)

:: Remove all accessories from your firearm to prevent loss or damage. || 2 :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss

during shipment, so you may elect to purchase insurance from your carrier

Print

Reset

T.A. has A DIZIED & STICKY LUBRICATION NESIDUE CAUSING PARTS TO BIND & WORK SLUGGISH. CAN OF REN to juplace TPA, CLEAN + TEST FINE AT 1/2 NORMAL LOST.

http://www.remington.com/asp/general repair form.asp

P

12/31/2012





