

cc: R.L. Hall
C.B. Workman
W.E. Leek

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE



TO: E.G. LARSON

FROM: G.W. MARTIN

SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

RECEIVED
MAR 27 1975
E. G. LARSON

The safety was checked on a total of 354 rifles.

We used three (3) methods, as follows:

- Safety was placed in "mid" position, trigger was then pulled, and then the safety was released.
- Safety was placed in "mid" position, trigger was pulled, safety was then placed on safe, and the safety was next released.
- Safety was in fully on position, trigger pulled (very hard), and safety was released. *Note: This check was not made on first five (5) guns - reason, Bill Carter was checking these.

Results:

Total guns unable to "trick".....	39
Total guns "tricked" by A or B. (above).....	154
Total guns "tricked" by both A and B	152
Total guns "tricked" by C.....	4
	349
	+ 5
	354

Codes for 350 rifles.

CU Apr. 71.....	23
KU May 71.....	2
AW Mar. 72.....	7
PX June 73.....	3
OX July 73.....	23
RX Nov. 73.....	43
XX Dec. 73.....	175
BY Jan. 74.....	31
CY Apr. 74.....	2
DY Sept. 74.....	41
	350



RECEIVED
MAR 31 1975
OFFICE - E. F. BARRETT

C.B. Workman
W.E. Leek

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE

Remington



-2-

 
SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

Codes for the four (4) rifles that would fire by "C" method:

RX Nov. 73.....	2
XX Dec. 73.....	1
BY Jan. 74.....	1
	<u>4</u>

Les Freer, Houston Gunsmith, was contacted. He repairs the 600 in one or two ways. He said that sometimes it is just a matter of trigger adjustment and other times it needs a new safety. Les said that prior to 1973 repairs of this nature were rare.

Sincerely,


G.W. Martin, Supervisor
Firearms Product Service

GWM:tpp