

TO: J. M. 2-13-81

P. 1723 ONE REMEDIATION REPORT NUMBER: 493 MODEL: 600

ORIGINAL CONDITION: PAIR RB: 18979

CURRENT YRQ: SAFETY APPEARS TO HAVE DATE: 7-23-81

BEEN REMOVED + REASSEMBLED W/ RING TECH: 4 SPT 602 105

FIRE AND TYPE: NOT KNOWN 4219 CAN/NO OR

A CONDITION: OUR # 1 A6407055

PROP: V IMP: 62 TEST: 70 CODE: LO-2-77

REPAIR: OK QA/QAL: 243

BENCH OPENED: OK CHECKED BY: M-HARDY

BENCH SHUTTER: OK APPROVED: 9/21/81

CLERK: OK APPROVED: 9/21/81

TEST: APPROVED: 9/21/81

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: 9/21/81

BRIGHT METAL ON BBL. SLIGHT MARKS ON STOCK

SAFETY ARM BROKEN AT THUMB PIECE

SAFETY PIVOT PIN AND SAFETY PIVOT PIN

RETAINER WASHED REVERSED

COMPLAINT: FIRES ON CLOSING OF BOLT

INCIDENT:

COMMENTS: Unable to duplicate customer complaint.

5 1/2" Torgin Pull .0095" seen lift. Gun passes link test.

Replace fire control.