

P.I. YES GUN EXAMINATION REPORT NUMBER: 115 MODEL: 700
GENERAL CONDITION: GOOD R #: 16182
OUTSIDE WORK: SLING STRAP STOPS AND DATE: 5-23-79
SCOPE MOUNTS ADDED FROM: VEAGERS
3101 NW AVE
FIRED AMMO TYPE: NOT KNOWN BELLINGHAM WASH.
& CONDITION: _____ GUN #: A6298578
PROOF: RIP INSP.: 71 TEST: 112 CODE: K-1-5-76
HEADING: OK GA./CAL.: 7MM MAG.
BREECH OPENING: OK CHECKED BY: MA-H-1001
RECOIL SHOULDERS: OK APPROVED: OK
CHAMBER: OK APPROVED: 901 6/2/79
TEST: _____ APPROVED: 1/3 6-22-79
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: OK 6-22-79
SLIGHT MARKS IN STOCK

COMPLAINT: GUN GOES OFF WHEN SAFE IS
RELEASED

INCIDENT: SHOT HOLE THRU DOOR OF PICK UP TRUCK

COMMENTS: Unable to duplicate customer complaint

- Gun Wt 008

- Target Ball 4 1/4"

2. ... to 4.75"

June 25, 1979

Yeager's Incorporated
P.O. Box 2549
3101 Northwest Ave.
Bellingham, Washington 98225

Gentlemen:

Examination has been completed on your customer's Model 700 7mm Rem. Mag. caliber rifle, serial number A6298588, which allegedly fired when the safety was pushed to the "fire" position.

Our experts thoroughly examined the rifle and trigger assembly and could not duplicate the incident you have described. All parts tolerances and dimensions were found to be normal, including sear-connector engagement. Also, factory seals were intact on the trigger adjustment screws, indicating no alterations were made to the trigger outside of our company.

Based on our findings, Remington Arms Company, Inc., cannot accept any liability or responsibility for this incident. We can only assume that as the safety was pushed to the "fire" position, contact was made with the trigger. When the safety is in the "on safe" position, the sear is lifted off of the trigger connector and very little effort is required to pull the trigger rearward unknowingly, thus taking the trigger out from under the sear. If the trigger is held in the rearward position while the safety lever is moved to the "fire" position, the sear having no trigger to rest on, drops away from the notch in the striker as soon as the disconnector is moved away by the safety lever, thus causing the striker to move forward and the gun to fire.

This happens so fast that the shooter does not realize he has pulled the trigger and he attributes the "accidental" firing to gun malfunction.

bcc: E.F. Barrett
J.E. Preiser
E.G. Larson
J.H. Chisnall
R.B. Sperling
F.D. Cole

R-16182

June 25, 1979

-2-

We trust that we have clarified the circumstances that could possibly have caused the accidental firing. The firearm can be returned as received, or, if your customer so desires and as a gesture of good will, even though there is nothing wrong with the present trigger assembly, we can replace it with another assembly at no charge. We will await the decision and reply.

Thank you for having afforded us the opportunity to examine the rifle and to be of service.

Sincerely,

J.A. Stekl, Supervisor
Firearms Product Service

JAS:tp



REMINGTON ARMS COMPANY, INC.



SPORTING FIREARMS

TRAPS

POWDER METAL PARTS

ILION, NEW YORK

AMMUNITION, BRIDGEPORT, CONNECTICUT

IONOKE, ARKANSAS

MANUFACTURERS OF

SPORTING FIREARMS. AMMUNITION

TRAPS

TARGETS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

RECEIVED

PETERS CARTRIDGE DIVISION

BRIDGEPORT, CONNECTICUT

TARGETS, ADA, OKLAHOMA

ATHENS, GEORGIA

FINDLAY, OHIO


CABLE—HARTLEY, BRIDGEPORT

JUL 26 1979

June 25, 1979

J. A. STEKL

Yeager's Incorporated
P.O. Box 2549
3101 Northwest Ave.
Bellingham, Washington 98225

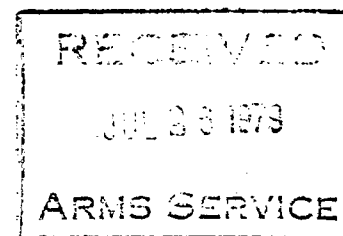

Gentlemen:

Examination has been completed on your customer's Model 700 7mm Rem. Mag. caliber rifle, serial number A6298588, which allegedly fired when the safety was pushed to the "fire" position.

Our experts thoroughly examined the rifle and trigger assembly and could not duplicate the incident you have described. All parts tolerances and dimensions were found to be normal, including sear-connector engagement. Also, factory seals were intact on the trigger adjustment screws, indicating no alterations were made to the trigger outside of our company.

Based on our findings, Remington Arms Company, Inc., cannot accept any liability or responsibility for this incident. We can only assume that as the safety was pushed to the "fire" position, contact was made with the trigger. When the safety is in the "on safe" position, the sear is lifted off of the trigger connector and very little effort is required to pull the trigger rearward unknowingly, thus taking the trigger out from under the sear. If the trigger is held in the rearward position while the safety lever is moved to the "fire" position, the sear having no trigger to rest on, drops away from the notch in the striker as soon as the disconnecter is moved away by the safety lever, thus causing the striker to move forward and the gun to fire.

This happens so fast that the shooter does not realize he has pulled the trigger and he attributes the "accidental" firing to gun malfunction.



REMINGTON ARMS COMPANY, INC.



SPORTING FIREARMS

TRAPS

POWDER METAL PARTS

ILION, NEW YORK

AMMUNITION, BRIDGEPORT, CONNECTICUT

LONGOKE, ARKANSAS

MANUFACTURERS OF

SPORTING FIREARMS. AMMUNITION

TRAPS

TARGETS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

PETERS CARTRIDGE DIVISION

BRIDGEPORT, CONNECTICUT

TARGETS, ADA, OKLAHOMA

ATHENS, GEORGIA

INDIAN, OHIO

CABLE—HARTLEY, BRIDGEPORT

June 25, 1979

-2-

We trust that we have clarified the circumstances that could possibly have caused the accidental firing. The firearm can be returned as received, or, if your customer so desires and as a gesture of good will, even though there is nothing wrong with the present trigger assembly, we can replace it with another assembly at no charge. We will await the decision and reply.

Thank you for having afforded us the opportunity to examine the rifle and to be of service.

Sincerely,

J.A. Stekl, Supervisor
Firearms Product Service

JAS:tpp

That is fine, so that
and send the gun back
to us. Thank you
W. R. Poore

YEAGER'S

OVER 100,000 ITEMS

DO NOT INSURE - IF
SHIPPED PARCEL POST

P.O. Box 2549
3101 Northwest Ave. - (206) 733-1080
BELLINGHAM, WASHINGTON 98225

REMINGTON ARMS CO,
11101N AVE (SVC. DEPT)
ILLION, NEW YORK 13357

Date 11-30-79
Salesman _____
Substitution Yes ☐ No ☒
B/O Accepted Yes ☐ No ☒
Ad Allowance Yes ☐ No ☒
Terms Net As of _____
Freight Terms _____
Prepaid ☐ FOB ☒ Full ☐
Ship via UPS

13C-0777
Must Appear On All Invoices, Packages
and Communications
SHIP Now
Cancel After 11-30-79
If Unable to Ship on Time - Notify at Once.
Vendor Responsible for Shipping Cheapest
Classification and for Excessive Freight
Charges on Accepted Back Orders.
All Goods Shipped After the 25th Must Be
Billed the First of Next Month.

IN FILLING THIS ORDER, VENDOR AGREES TO ALL TERMS OF THIS PURCHASE ORDER. Ship via

QUANTITY ORDERED	QUANTITY RECEIVED	UNIT	ITEM NO.	DESCRIPTION	UNIT COST	UNIT EXTENSION	UNIT LIST	OUR RETAIL
THIS IS NOT A PURCHASE ORDER STOCK FOR REPAIR OR CREDIT								
<i>Customer</i>								
<i>La AOL Mod NO GRAM # 16298588.</i>								
<i>gun, gun Mod. Cal.</i>								
<i>w/ling & water base.</i>								
<i>John Varner the gun sales all the way</i>								
<i>310 pipes a. gun is released Customer that</i>								
<i>St. 1. Lyndle hunt. sales here his work up soon. no one</i>								
<i>ph. 351-5343 Please call in place - back</i>								
<i>reg. # 2229 W. W. Ware mgr. OH</i>								
<i>Office</i>								
<i>RECEIVING COPY</i>								
<i>PURCHASED BY: [Signature]</i>								
<i>CONTROLLER</i>								
<i>WE REQUIRE SLICKS TOTAL COST</i>								

cc: D. Polley
DON'T SAY IT-WRITE IT

To F.D. COLE Location _____
From J.A. STEKL Location _____ Phone No. _____
Subject R-16182 - M/700 7mm Rem. Mag caliber S.N. A6298588 Date 7/26/79

 
Please replace trigger assembly on this rifle and return to:

Yeager's Incorporated
P.O. Box 2549
3101 Northwest Ave.
Bellingham, Washington 98225

Keep the old trigger assembly on file for possible future reference.

Please have work done & return made as soon as possible.

Thank you.


JAS:tpp

RD 770

STOP, LOOK, AND LIVE