

tricking.)

In addition to the above sample of 700's, 19 Model 700's have been returned to Ilion in response to the Model 600 recall with the complaint that the gun will fire when the safety lever is moved to the "fire" position. Remington found that only one of those guns could be tricked, the cause being insufficient clearance. Three other guns did fire with the safety being moved, but for reasons associated with owner alteration of the product. In one instance, an owner was about to return a gun for accidental discharge upon release of the safety; but just before sending the gun, the owner discovered that he was inadvertently pulling the trigger as he released the safety. It is suspected that this was also the case with the remaining 15 guns, since they were found to be in proper operating condition.

Remington has run quality audits on competitor bolt action rifles and has found that a large percentage of competitor models can be tricked. This includes some famous guns, such as the "Springfield" 30 caliber rifle, which was used in quantity in both World Wars.

The Subcommittee discussed the issue of tricking, as well as other causes of accidental discharge. It was decided that tricking, along with problems such as owner adjustment of the trigger engagement screw or the trigger adjustment screw, finger on the trigger when the safety is released, and trigger assembly alterations, are really problems more associated with abnormal use or misuse of the product rather than indication of a defective