

RECEIVING AND ESTIMATING REPORT

L		CUSTOMER ORDER NO.		COMMENTS	
RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE	ORDER
7/05/91	06/10/91	BU 1-71	6400232	700 243 BDL	R 91-12162
SSORIES W/STUDS					

L/REAR SIGHT

M: CARLS RELOADING CENTER
435 EAST 3RD NORTH
RICHFIELD UT 84701

SHIP TO: CARLS RELOADING CENTER
435 EAST 3RD NORTH
RICHFIELD UT 84701

L	J	L
JUNT NUMBER	ACCOUNT NUMBER N/C	WRITE <input type="checkbox"/> CLEAN/TEST
PROM. DATE	ESTIMATED	VIA UPS

AIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
------------	-----	-----------	-----	-------------	-------

IN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED

COMER'S REQUEST *fires when safety is moved.*

N FAULT *Could not duplicate complaint after many attempts! However, removal of action from stock revealed trigger assembly had been tampered with inside factory. Sealant on adjusting screws was not original. Overtravel had been altered and was insufficient. Trigger pull 3 pounds; run lift 0025"*

We can either re-adjust over-travel and return rifle or, we can install a new trigger assembly at \pm normal cost, as a gesture of good-will, if it will better restore confidence in the rifle.

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
<i>H-B</i>					
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV. 7/90