

Rec
1-9-89

Remington.



REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

PP-33486

December 28, 1988

Ron Coleman, Gunsmith
10836 Grissom, Suite 107
Dallas, Texas 75229

Dear Ron:

We have completed examination of the Model 700 BDL, 270 Cal., serial number B6331899, which the customer said "fired at two different times," when he was trying to extract live rounds from the chamber.

The gun, which shows a manufacturing date of June 1981, has all our high pressure proof test, gallery test, and final inspections stampings, indicating it had passed all necessary tests and inspections prior to shipment.

While the general condition of the gun was exceptional, considering its age, a few scratches and dents were noticed on the stock. In examining the individual parts, we found headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly could not duplicate the reported malfunction. Factory seals were intact on the trigger adjustment screws, indicating no adjustments had been made to the trigger outside our factory. Trigger pull was measured to be 5 1/4 pounds, and sear lift with the safety in the "on-safe" position well within specifications at .009. The only manner in which the rifle could be made to fire was with the safety in the "off-safe" position and the trigger pulled, as designed.

Since we found the firearm would function normally in every respect, we are prepared to return it in its present condition. However, if you or your customer desire, we will install a new trigger assembly at no-charge, as a gesture of good-will, if it will restore confidence in the rifle. We will await your customers' decision and your reply.