

Remington.



REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

May 15, 1989

RECEIVED

MAY 30 1989

J.A. STEKE

Custom Gun Works
4952 Johnston St.
Lafayette, LA 70503

Gentlemen:

Examination has been completed on the Model 700 BDL 300 Mag. caliber rifle, serial number A8687195, that you returned to us a short time ago because "customer claims that on one occasion the rifle fired when he took the safety off".

The general condition of the rifle appeared to be good; however, it was noted that the stock contained numerous dents and scratches. In addition, the rifle has been re-barreled and the stock epoxy bedded after it originally left our factory.

Examination and functioning of the rifle and trigger assembly could not produce any malfunctions. Many attempts were made to cause the rifle to fire upon movement of the safety without success. All tolerances and dimensions were found to be normal - trigger pull was measured at 5 pounds and sear-lift with the safety in the on safe position was well within specifications at .010". However, it was noted that the sealant had been removed from all three (3) trigger adjustment screws, indicating adjustment was made outside our factory.

Since we found the firearm to be completely correct and to function normally in every respect, we are prepared to have the rifle returned in its present condition (after re-sealing the trigger adjusting screws). However, if your customer desires, we will install a new trigger assembly at no-charge, as a gesture of goodwill, if it will restore confidence in the rifle. We will await the decision and reply.