

*M/700 Customer Complaint.*

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700  
GENERAL CONDITION: NEW R #: 012758  
OUTSIDE WORK: FRONT ADJUSTING SCREWS DATE: 6-12-72  
UNSEALED. FROM: J.V. ELIOT JR.  
FIRED AMMO TYPE: - SAN MEOTO, CALIF.  
& CONDITION: \_\_\_\_\_ GUN #: 6446926  
PROOF: R.E.P.-L ASSEM. 30 INSP.: 51 TEST: 84 CODE: DU= 9/71  
HEADING: O.K. GR./CAL.: 17 REM.  
BREECH OPENING: - CHECKED BY: C. PROSSER  
RECOIL SHOULDERS: EXCESSIVE RADIUS APPROVED: \_\_\_\_\_  
CHAMBER: O.K. APPROVED: \_\_\_\_\_  
TEST: NO APPROVED: \_\_\_\_\_  
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_  
CORNER OF SEAR CHIPPED OFF. FIRING PIN HOLE NOT  
ROUNDED. FIRING PIN HOLE, REAR, NOT CLEANED - FIRING  
PIN ASSEMBLY RUSTY. ENGAGEMENT UNDER MIN. - SEAR TO  
CONNECTOR.  
COMPLAINT: FOLLOWS DOWN  
INCIDENT: FOLLOW DOWN  
COMMENTS: EVIDENTLY THE CUSTOMER EXPERIENCED A PIERCED  
PRIMER, WHICH WITH UNDER MIN ENGAGEMENT CAUSED  
THE CORNER OF THE SEAR TO CHIP OFF.