

dec. Arms Service  
R89-01347  
make repairs - no charge

**Remington.**



**REMINGTON ARMS COMPANY, INC.**

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

February 7, 1989

Mr. Greg Kirk  
%SOP Inc  
663 Hwy. 90E  
Sealy, TX 77474

Dear Mr. Kirk:

Examination has been completed on your Model 700 ADL 270 caliber rifle, serial number B6274468, that you returned because the rifle fired when the safety was released, and it delayed firing after the trigger was pulled.

The returned firearm, which was produced in June 1981, was found to contain our high-pressure proof test, gallery test, and final inspection stamping, indicating that it had successfully passed all necessary tests prior to shipment from our factory.

Removal of the barrel-action from the stock assembly revealed that the trigger assembly was wet with excessive oil(?). We also found evidence that the bolt stop pin had been removed and not installed far enough to clear the side of the stock inletting, the rear of the trigger housing was also sprung inward at the time the pin was installed causing the sear safety cam to bind slightly on the inside wall of the housing. In future use, we strongly advise that the trigger assembly not be removed or adjusted by untrained non-Remington personnel and, oil be used sparingly on the firearm and not let accumulate in or on the trigger assembly, as these conditions could adversely affect the operation of the trigger assembly.

Mr. Kirk, as a gesture of good-will we are installing a new trigger assembly at no charge, and re-testing your rifle before we effect return shipment.

Thank you for affording us the opportunity to examine the rifle