

*Remington*



**REMINGTON ARMS COMPANY, INC.**

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

January 8, 1990

Lott True Value Hdwe.  
306 S. Peterson Ave.  
Douglas, GA 31533

Dear Sir:

Examination has been completed on the Model 700 BDL 30-06 caliber rifle, serial number B6485391, that you returned to us a short time ago with the alleged complaint that the gun fires "when the safety is engaged."

The returned firearm, which was produced in August of 1983, has been thoroughly examined and found to have our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to being shipped from our factory.

The general condition of the rifle appeared to be good and, in going over the individual parts, we found the headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly could not produce any malfunctions. All tolerances and dimensions were found to be normal. Trigger pull was measured at 4-1/2 pounds, and the sear-lift with the safety in the "on-safe" position was well within specifications at .010".

Removal of the barreled-action from the stock did reveal that the action and trigger assembly contained an excessive amount of solidified lubrication and dirt. The bolt stop and bolt stop release were very sticky and movement of these components was very sluggish.