

DON'T SAY IT - WRITE IT

TO: *Mr. Kinzer*

FROM: *Remington-Union*

Page
No.

Re: *W.D.S. Mfg. Co. and A/R 36954*

Date: *3/2/50*

Re: *W.D.S. Mfg. Co.*

*The customer has accepted our offer to replace the trigger assembly,
the original rifle at our shop, as a gesture of good will.
Please install the above H.S.P. and return the rifle to
the customer. Return C.O.D. for 10.00 including return shipping.*

*Harley,
Jr.*

STOP, LOOK AND LIVE

been thoroughly examined and found to contain our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to shipment from our factory.

The general condition of the rifle appeared to be good, and it was noted that scope mounts and a recoil pad had been added after the firearm originally left our factory. In going over the individual parts, we found the headspace, chamber and recoil shoulders all to be normal.

Examination of the rifle and trigger assembly could not duplicate the malfunction you reported. Many attempts were made to cause the rifle to fire upon closing the bolt, but it did not happen. Trigger pull was measured to be 2-3/4 pounds (well below our minimum specification of 3-1/2 pounds) and the sear lift with the safety in the "on-safe" position was within specifications at .015".

Disassembly of the rifle revealed that the trigger assembly had been tampered with after it left our factory, as evidenced by a different pattern on the adjusting screws. In the future, we strongly advise that the trigger not be adjusted by untrained non-Remington personnel.