

RECEIVING AND ESTIMATING REPORT

CUST NO: 050773 C.O.D		COMMENTS			
ITAL	CUSTOMER ORDER NO.				
PS					
TE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE	ORDER
0/07/91	10/09/91	WR 8-68	365767	700 243 WIN ADL	R 91-20313
ACCESSORIES	W/STUDS	L/SIGHTS	SCOPE BASE		

FROM:

TINSLEY, JACK
BOX 183
LIVINGSTON
USA

MT 59047

SHIP TO:

TINSLEY, JACK
BOX 183
LIVINGSTON
USA

MT 59047

COUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED 10-18	VIA UPS
--------------	--------------------	--------------------------------	------------	------------	-----------------	---------

AIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
------------	-----	-----------	-----	-------------	-------

GUN CONDITION:

☐ NEW☐ SLIGHTLY WORN☐ VERY WORN☐ MISUSED☐ MARRED

CUSTOMER'S REQUEST

discharged while closing the bolt

IN FAULT

Cannot duplicate complaint. However, examination of trigger assembly revealed the inside is contaminated with a greasy, sticky substance. The rear-safety cam is not moving properly, due to substance on inside of trigger-side-plate. Trigger pull measured at 4 $\frac{3}{4}$ #; rear lift .009"

TS

Due to age of rifle, offer new trigger assembly at $\frac{1}{2}$ normal cost as a gesture of good-will

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
BSWT					
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6923 REV. 7/90