Remington.

OIPIND

R-89-06532 Make repairs at nocharge, fit new trigg assembly. 곜

REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

March 13, 1989

Tom's Shooters Supply 910 6th Street Albany, MN 56307

Dear Mr. Heinzel:

Our examination has been completed on the Model 700 7mm Mag L.H. caliber rifle, serial number B6237382, that you returned with the alleged complaint that it discharged without pulling the trigger.

The returned firearm, which was produced in May of 1980, has been thoroughly examined and found to bear our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to shipment from our factory.

The general condition of the gun appeared to be good. In going over the individual parts, we found the headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly could not produce any malfunctions. <u>All</u> tolerances and dimensions were found to be normal. Trigger pull measured to be 5-1/2 pounds, and the sear lift with the safety in the on safe position was well within specifications at .008.

It was noted that inside the trigger assembly contained dirt and excessive lubrication. The bolt stop and bolt stop release were also covered with a sticky substance and movement was very sluggish.