

RECEIVING AND ESTIMATING REPORT

AL		CUSTOMER ORDER NO.		COMMENTS W/ BOTTOM HALF OF SCOPE MNTS	
RECEIVED 12/91	DATE OPENED 02/19/91	DATE CODE CD 4-77	SERIAL NUMBER A6444481	MODEL AND GRADE 700 270 BDL	ORDER R 91-04878
ACCESSORIES W/STUDS		L/SIGHTS			

FROM:	SHIP TO:				
YOUNG, CHARLES H 13401 REDCOAT LANE PHOENIX MD 21131	YOUNG, CHARLES H 13401 REDCOAT LANE PHOENIX MD 21131				
COUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐ CLEAN/TEST	PROM. DATE	ESTIMATED	VIA UPS

AIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
IN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED					
CUSTOMER'S REQUEST					

"However, as I closed the bolt, the chamber would fire"

TS
Cannot duplicate complaint. However, the trigger assembly has been improperly adjusted outside the factory - factory without removing from all adjustment screws - 1) insufficient over-travel 2) insufficient rear engagement 3) Trigger pull below spec at 2 1/2 - 2 3/4 pounds. Also, as noted, the magazine top was installed upside-down.

Send repair quotation for new-style trigger assembly (2nd - best bid) at 1/2 normal cost, as a gesture of good-will.

note: scope bases at inspection

REPAIRMAN LEW	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY 5Te & L

RD6925 REV. 7/90