

Remington Arms Co., Inc.  
Product Service  
Legal Case #:3124

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
159564	1/22/2009	1/23/2009	1/23/2009				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Frank	Gagliano	229 North Drive	Lakewood	NJ	08701		H 732-367-3515 W 609-584-4386 C 732-278-2586 E nortonbyk@optonline.net

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause: <i>Could Not Duplicate</i>			
S	Gun fires when moved from Safe to Fire	Concern:1007	Fired on Safe Release	Unknown
C				

Rifle has a recurring problem of firing when safety is moved to Fire position. dmf

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/243 WIN	20000	A6523280	RO	11/17/1977
Date Purchased	Where Purchased	Accessories	Original Owner			
	WAMMES GUN BELEFONTAINE OH	SCOPE BASE, FRT HALF OF RING	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Repair at special price under BLSM program						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$62.38	1/27/2009				

1/27/09: Customer was mailed estimate for \$21.20. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/23/2009
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY

Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 243 WIN HB
	Date Code		RO
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	TRIGGER SLUGGISH
	Pull	---Select---	4.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE,BOTTOM HALF OF FRONT RING



3124

RO 11/77  
24"  
4.5"  
1008

Frank Gagliano  
229 North Drive  
Lakewood, New Jersey 08701

Serial Number: **A6523280**

Model: **700**



**RE00159564**

December 29, 2008

Remington Arms Company, Inc.  
14 Hoefler Avenue  
Ilion, New York 13357

Re: Model 700 BDL; SN A6523280; Safety Modification Program

Gentlemen:

This rifle has had a recurring problem of firing when the safety was placed in the "fire" position. I called the Remington Help Center and was advised that there was a recall notice by Remington for this "pre-1982" model for issues with the trigger/safety. I was instructed to return the gun to Remington for modification under the "Safety Modification Program". Enclosed, please find my personal check for shipping and handling.

I can be contacted by:

Home Phone 732-367-3515

Work desk 609-584-4386

Cell Phone 732-278-2586

e-mail [nortonbyk@optonline.net](mailto:nortonbyk@optonline.net)

Thank you.

could not duplicate concern.  
replace TPA, check over, clean  
under BOLT LOCK Program  
Rep \$ 20.00 + S+H  
Quote

Very truly yours,

*Frank Gagliano*  
Frank Gagliano

p.s. This rifle is incredibly accurate on ground hogs out to 300+ yards.