Remington Arms Co., Inc. Product Service Legal Case #:2943

Case Information

RE# **Date Opened** Date Opened(PS) Date Closed **Incident Date** Pre Lit Obsolete Lit 12/5/2008 12/5/2008 12/5/2008 156397

Customer Information

Last Name Street City State Zip Contact Type **Business** First Name Age H 229-563-0962 4916 Shiloh Rd Incident Henry Clay Hayes Hahira GA 31632 E achammer@windstream.net

Incident Information

Claims Codes Repair Est. **Medical Treatment Medical Status**

PΙ

PD Cause: 4015 Improper Maintenance

Unknown

S Fires on bolt closing

Concern:1008 Fired on Bolt Closing

Customer says, Weapon fires inadvertently - pushing bolt forward and down caused the rifle to fire without touching the trigger. This is an intermittent problem. I have a fear of this weapon and asked that you fix.

Firearm Information

Mfg. Туре Model/Ga. SKU Serial Bbl. **DOM** 700/270 20000 CF/BA B6234282 Remington OA 7/16/1980

Date Purchased Where Purchased Accessories **Original Owner**

DAVIDSON SUP GREENSBORO N C

U

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date

Reimbursement Cash Settlement Reim. Date APV Cash Date APV

BLM program

Repair/Replacement Cost Repair/Replacement Date

45.00


12/8/2008

12/5/2008 Returned to AS for bolt lock modification program. Clean action and install new TA under the program fls.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		Supry
	Exam Date]	12/5/2008
	Product Type]	RF
	Action Type		A
	Assigned To		Supry
Cause	4015	Improper Maintenance	The sear is sticking - when the trigger is pulled the firing pin release is delayed due to the sticky build up. Sometimes the sear does not return to its proper position and the firing pin will fall upon bolt closing. Sometimes the trigger will stick
Barrel	Description]	22 inch model 700 270 caliber
	Date Code]	OA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown	Slightly Worn;	

L	Condition	Functioning		•
Bolt	Firing Pin	Worn; Functioning		
	Shroud	Slightly Worn; Functioning		
	Face	Slightly Worn; Functioning		
	Handle	Slightly Worn; Functioning		
	Stop	Abused; Not Functioning	Stop is stuck due to sticky build up	
Extractor	Condition	Slightly Worn; Functioning	·	•
	Cut Condition	Slightly Worn; Functioning		
	Ext/Eject Test	False		
Locking	Block Condition	Select		
	Lug Condition	Slightly Worn; Functioning		
	Notch Condition	Select		
Magazine	Condition	Slightly Worn; Functioning		
	Box Condition	Select		
Overall	Exterior Condition	Slightly Worn; Functioning		
	Stock Condition	Slightly Worn; Functioning		
	Fore End Condition	Select		
Receiver	Condition	Slightly Worn; Functioning		
	Bulged	False		
Safety	Description		Model 700 Bolt Lock	
	Function	Slightly Worn; Functioning		
	Sub-Assembly	Non-ISS		
Sear	Lift	Select	not measured	
	Notch	Slightly Worn; Functioning	Notch ok.	·
		Condition	Abused; Not Functioning	The sear is sticking due to sticky residue build up in the TA
Pull	Trigger	Select	5.0 lbs	
Altered]	False		
Sub-]	M/700 Bolt		
Assembly	<u> </u>	Lock	<u> </u>	

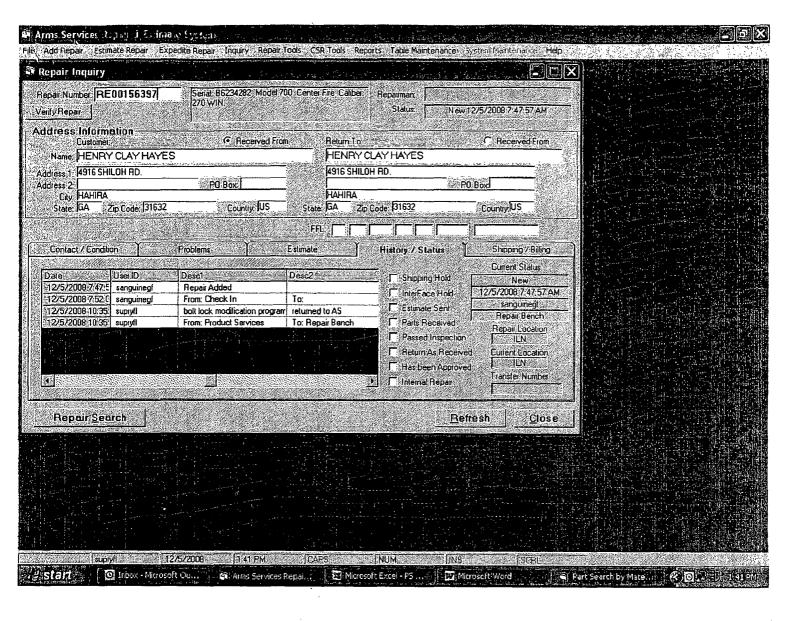

D	EC	3		W I	
	CEC	0	8	₩ <u>1</u> 2008	
B.	Y•				

Model 700 Safety Modification General Repair Form



Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: 700 / .270 CALIBER	Serial Number: 86234282				
Name: HENRY C. HAYES	Date of Purchase: 1982				
Address (no PO Boxes): 4916 SHILOH ROAD					
City: HAHIRA	State: GA	Zip: 31632			
Phone (Daytime): 229-563-0962	Fax: 229-794-1270	Fax: 229-794-1270			
E-mail Address: achammer@windstream.net					
WEAPON FIRES INADVERTENTLY: MODEL 700 SAFET REMINGTON REPRESENTATIVE I TALKED TO O/A OCT PUSHING BOLT FORWARD AND DOWN CAUSES THE R THE TRIGGER. THIS IS AN INTERMITTENT PROBLEM. I ASKED THAT YOU FIX. NOTE: BOLT IS IN BOX NEXT TO BARREL ALSO TAKE IS SCREWS ARE REMOVED. THANKS	15, 2008. IFLE TO FIRE WITHOUT TOU HAVE FEAR OF THIS WEAPO	ICHING DN AND			
NOTE: Prior to shipping your firearm, contact the Repair Cer	nter for services provided and e	estimated repair time.			
(I) WARNING: DO NOT SEND LIVE OR SPENT SHELLS FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF Y THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, A SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss of the your ENSURED firearm by either UPS or Parcel Post during shipment, so you may elect to purchase insurance	OU FEEL YOU MUST SEND SADDRESS (WITH ZIP CODE), in shipping and handling. Prefer or damage. Remington is not responsible	SPENT SHELLS PLEASE SEND TELEPHONE AND MODEL AND rerably, ship in a			

©2008 Remington Arms Company, Inc. All Rights Reserved.
Investor Relations | Other Remington Brand Products | Legal Notices | About Us

Visit Our Other Websites

Other Sites

Remington

Refund to AS

to Clean action of

to Clean action of

Instruct New TA under

The BLM prosperson

the BLM prosperson

Quare \$20.00

Quare \$520.00

B6234282 RAE # 156397

http://www.remington.com/support/repair_services/general_repair_form.asp

11/16/2008