

Remington Arms Co., Inc.
Product Service
Legal Case #:5450

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
214509	12/14/2010	12/16/2010	12/16/2010				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	D & R Sports Ctr.	---	D & R Sports Ct	8178 W. Main St.	Kalamazoo	MI	49009		W 269-372-2277 F 269-372-9072

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4013 Broken or Missing Parts		Unknown	
S	Concern:1028 Fired With Safe ON			
C	Fires with Safe on			

Dealer sent gun in. They stated gun will fire while working the bolt with the safety on. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	600 Mohawk/243 WIN	n/a	6885676	WZ	8/11/1975
Date Purchased	Where Purchased	Accessories	Original Owner			
	JOHNS SPTG CANTON OHIO		U			

CONCERN:FIRED W/SAFE ON

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/600 Mohawk/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Repair @ n/c under recall						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$60.01	1/7/2011				

Per Ilion - Safety snap washer out of position, detent ball missing. TA has not been changed under recall. Fit new TA @ n/c, test fire. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/16/2010
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4013	Broken or Missing Parts	

Barrel	Description		18.5" 243 WIN
	Date Code		WZ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/600 SAFETY
	Function	Like new; Not Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.014
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	SAFETY SNAP WASHER IS OUT OF POSITION DETENT BALL IS MISSING
	Pull	---Select---	4#
	Altered	False	

BARBER - Kinzer PPS GAL RE 0009585

	Sub-Assembly	Other Remington
--	--------------	-----------------

D & R SPORTS CENTER, INC.8178 W. Main Street
KALAMAZOO, MI 49009

(269) 372-2277

FAX (269) 372-9072

TO

Remington Arms Co. INC
Attn: Armed Services Division

14 Hoefler Ave

Ilion, NY 13357

DATE 12-8-10

☐ URGENT☐ SOON AS POSSIBLE☐ NO REPLY NEEDED

FILE NO.

ATTENTION

SUBJECT

6019

4#
WZ 47
18.5#
.014**MESSAGE**

Mohawk 600 243 Win 6885676

Gun will fire while working the bolt with the safety on.

SIGNED

REPLY

DATE OF REPLY


6885676

Model: 600 MOHAWK



RE00214509

 SIGNED



BY:.....

Safety swap when out of position,
 Detent ball missing. T.A. has not
 been changed under m/600 recall.
 fit new TPA at N/C test fire.

#230145