Remington Arms Co., Inc. **Product Service** Legal Case #:4614

Case Information

RE# Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete **Date Opened** 6/22/2010 6/22/2010 197510 6/21/2010

Customer Information

First Name **Last Name** Street **Business** City State Zip Age Contact Type

Orchard Pawn Sh 615 Thain Rd Lewiston ID 83501 Reporter Orchard Pawn Shop

Zack Bakker 1218 11th St Lewiston ID 83501 H 231-638-7388 Incident

Incident Information

Codes Repair Est. Medical Treatment Medical Status Claims

PΙ

 \mathbf{C}

Improper Maintenance PD Cause:4015

Unknown

S fired on bolt closing Concern:1008 Fired on Bolt Closing

6/23/10 Per letter with rifle, initially the problem was with it not firing. Then they had an incident during that same hunt with it firing when closing the bolt on a round.cm

Firearm Information

Model/Ga. SKU Mfg. Serial Bbl. **DOM** Type 700/280 REM Remington CF/BA 26911 T6204078 XN 12/2/1993

Date Purchased Where Purchased Accessories **Original Owner**

GANDER MOUNTAIN INC #110

CONCERN:FBC

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Cash Reim. Cash Settlement Release of Claims Release Date Reimbursement Date Date Settlement APV APV

Per Ilion, replace TPA, clean at 1/2 normal charges as goodwill

> Repair/Replacement Repair/Replacement Cost Date

6/23/10 Per Ilion, trigger assembly is contaminated with a partially dried and sticky lubrication residue, causing parts to work sluggish. Replace TPA, check over, clean at 1/2 normal charges.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		6/22/2010
	Product Type		RF
	Action Type		A

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4614&Type=Case

6/23/2010

` · _	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	
Barrel	Description		24" 280 REM SS
	Date Code		XN
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
•	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Magazina	Condition	Select	
Magazine	Box Condition	Slightly Worn; Functioning	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receive	Bulged	False]
Safety	Description		STANDARD M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.012
	Notch	Slightly Worn; Not Functioning	WORKS SLUGGISH
	Tests	Test Fired	False
Feeding Test		False	
	Condition	Slightly Worn; Not Functioning	DIRTY/STICKY,PARTS WORK SLUGGISH
Trigger	Pull	Select	4#
1118801	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	

pair Inquiry				
ak Number: RE00197510 y Repair	Serial: T6204078 Model 700 C 280 S/S BLK SYN Produced: 1	2/02/1993	6/22/2010 8 26 11 AM	
ress Information	6.8 45			
Customer: Name: ORCHARD PAWN SH	G Received From HOP	Return To: ORCHARD PAWN SHOP	C Received From	
ess 1, 615 THAIN RD ess 2	PO Box	615 THAIN RD PO I	lox.	
City ILEWISTON State: ID Zip Code (83501	Country: US	LEWISTON State: ID Zip Code: (83501	Country:US	计划数据 12年
ini (i i saga est inimatings). Sagan		_{₽₽} ₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽₽	- went with the land of the land	
Contact / Condition]	Problems Est	mate History / Status	Shipping / Billing Current Status	
ste Code /17/2010 2:59:1 New	User ID Desc1 pescatorva Repair Added	Shipping Hold	Estimating 6/22/2010/8:26:11 AM	图数 建铁矿 计
/22/2010 8:26:1 Maint	Travistow RepairMainte	nance Estimate Sent	pescalore Repair Bench	
		☐ Parts Received ☐ Passed Inspection	Repair Location	
		T Return As Received	J ILN <u>Current Location</u>	
	Telegraph of	Has been Approved	ILN . Transfer Number	4.43世纪长年世代
		b 1 Thatamat Danah		
1 2	2 - 5000 (372 old - 800) 2 (70 degs	<u>▶</u>] ☐ Internal Repair		
Repair <u>S</u> earch			The second	
			The second	

1	<u> Z</u> C	<u> </u>	1	で 15 2010	
Ŋ	JUN	2	3	2010	
B.	γ.				

4614

6 June, 2010

Remington Arms Company Attn: Arms Service Division 14 Hoefler Ave. Ilion, NY 13357

Dear Remington:

First I would like to thank you for making such a fantastic product. It is such a breath of fresh air to find a product in today's age that is not only the best in its class but also cost effective. I can't tell you that I don't own other brands of guns, but I can tell you that when it comes to picking my favorites I always reach for my Remingtons.

5.

All that being said, last hunting season (on my last hunt of the year) I decided to take my wife out on her first deer hunt. We spotted a group of deer and we moved into position for a shot. As she took aim I was coaching her on what to do. She squeezed the trigger and the gun fired, but she missed the deer. She told me later that the gun had not fired right when she pulled the trigger and that is why she missed the deer. I told her that she had probably not pulled the trigger hard enough and we would try again the next day. The next day we were in the same spot. Right before dark a deer stepped out into the opening about 75 yards away. Jamie took aim and as I watched her flip the safety off and pull the trigger nothing happened. I grabbed the gun, took aim at the deer and pulled the trigger. Still nothing. I grabbed the bolt and ejected the shell thinking it had misfired. As I slid a new shell into the chamber and dropped the bolt, the gun fired into the ground at my feet without me pulling the trigger.

This gun has been my primary hunting gun for the past 10 season. I am very meticulous with all my guns; this gun especially, since I use it the most. I hope you can do something with it. I am not sure what's wrong with it, but the weather was very cold when this happened (if that has anything to do with it). This is the first time I have ever had a problem with any Remington. I know you will help restore my confidence in this gun.

Sincerely,

Zack Bakker 1218 11th St.

Lewiston, ID 83501

(231)-638-7388

T6204078

Model: 700

DE00197510

RE00197510

Trig. ASSM. is contaminated with a partially Dried and sticky lubrication residue causing parts to weak sluggish: Replace TPA, check open, clear at 1/2 Normal changes.

Dr. Water