BARBER - Kinzer PPS GAL RE 0013051

Remington Arms Co., Inc. **Product Service** 

Legal Case #:5000

Case Information

**Incident Date** RE# **Date Opened** Date Opened(PS) **Date Closed** Pre Lit Lit Obsolete 11/8/2010 X 209473 11/5/2010 11/17/2010

Customer Information

Street City State Zip Age Type Business First Name Last Name Contact H 704-219-2357

615 Fowler Rd Monroe NC 28110 Incident James Robert Walker Jr

E southernboykin@aol.com

Incident Information

Repair Medical Medical Claims Codes Est. Treatment Status

PΙ

PD Altered Adjustments or

Cause:4006 Components Unknown Fired when cycling rounds

w/o trig pull Concern: 1008 Fired on Bolt Closing

C

11/15/10 Per note with rifle, gun fired while he was cycling rounds through it, his hand was not on trigger. He blew a hole in his office door and cealing. The bolt is very loose and wobbly, it comes out too far and hits the stock.cm

Firearm Information

Mfg. Type Model/Ga. SKU Serial Bbl. **DOM** 

710/30-06 4/17/2003 8:28:22 71111971 CX CF/BA 27410 Remington SPR AM

Date Original Where Purchased Accessories Purchased

Owner

WAL-MART DC 6003R-REGULAR

CONCERN:FBC 11/16 Says he bought new 2-3 yrs ago. 11/17 from WalMart

Ammunition Information

Cal./Ga. SKU **UPC** Mfg. Type DOM Mfg. Code

N

Y

Remington CL/165

Concern Other Reload Factory

Alleges he has only shot 165 and occasionally 225 factory ammo

Other Products Information - None Defined

Settlement

Remington/710/CF/BA

Cash Reim. Cash Settlement Release of Claims **Release Date** Reimbursement Date Date Settlement APV APV

Repair at 1/2 normal charges as a gesture of goodwill

> Repair/Replacement Repair/Replacement

Cost Date

11/15/10 Per Ilion, improper adjustments, altered settings.cm 11/16/10 Emailed quote to Walker, his cell would not connect when I called cm 11/17/10 Per call from Walker, he wanted it repaired no charge, I told him the alterations were not from the BARBER - Kinzer PPS GAL RE 0013052 factory and that we would leave the estimate at 1/2 off and free shipping. He will pay but wants the old parts back and implied that he would contact a lawyer about the roof damage with this rifle. Emailed factory to take pictures before repairing.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/8/2010
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
	Description		22" 30-06 SPR
	Date Code		CX
	Bore Plugged	False	
	Bulged	False	
Barrel	Fired	False	Ī.
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	FRONT EDGES OF LOCKING LUGS ARE ROUNDED OFF AND SMOOTHED DOWN
	Notch Condition	Select	
Magazine	Condition	Select	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Worn; Functioning	
	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	

BARBE	R - Kinzer PPS GAL Bulged	<b>RE 0013053</b>  False	
Safety	Description		STANDARD M/710 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	Select	N/A
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	2.25#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	·

















