

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE

Remington

cc: R.L. Hall
C.B. Workman
W.E. Leek

March 26, 1975

RECEIVED
MAR 27 1975
E. G. LARSON

TO: E.G. LARSON

FROM: G.W. MARTIN

SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

The safety was checked on a total of 354 rifles.

We used three (3) methods, as follows:

- A. Safety was placed in "mid" position, trigger was then pulled, and then the safety was released.
- B. Safety was placed in "mid" position, trigger was pulled, safety was then placed on safe, and the safety was next released.
- C. Safety was in fully on position, trigger pulled (very hard), and safety was released. *Note: This check was not made on first five (5) guns - reason, Bill Carter was checking these.

Results:

Total guns unable to "trick".....	39
Total guns "tricked" by A or B. (above).....	154
Total guns "tricked" by both A and B.....	152
Total guns "tricked" by C.....	4
	<u>349</u>
	<u>+ 5</u>
	354

Grand total-315 rifles out of 354 could be tricked.

Codes for 350 rifles.

CU Apr. 71.....	23
KU May 71.....	2
AW Mar. 72.....	7
PX June 73.....	3
OX July 73.....	23
RX Nov. 73.....	43
XX Dec. 73.....	175
BY Jan. 74.....	31
CY Apr. 74.....	2
DY Sept. 74.....	41
	<u>350</u>

(continued)

PLAINTIFF'S
EXHIBIT

3051

AL 0022637

1 of 2

CC: R.D. Hall
C.B. Workman
W.E. Leek

RD-41 REV. 1-54

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE

Remington



-2-

SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

Codes for the four (4) rifles that would fire by "C" method:

RX Nov. 73.....2
XX Dec. 73.....1
BY Jan. 74.....1
4

Les Freer, Houston Gunsmith, was contacted. He repairs the 600 in one or two ways. He said that sometimes it is just a matter of trigger adjustment and other times it needs a new safety. Les said that prior to 1973 repairs of this nature were rare.

Sincerely,

G.W. Martin
G.W. Martin, Supervisor
Firearms Product Service

GWM:tpv

AL 0022638

2 of 2