

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE

Remington

Bridgeport, Conn.
October 30, 1978

To: Field Service Reps Visiting Texas
From: E. G. Larson
Subject: Gun Recall

The serial numbers of guns involved are as follows:

Remington Model 600	From Serial # 0001 to # 131,552
Remington Model 660	From Serial # 0001 to # 131,552
Mohawk 600	From Serial #6,200,000 to #6,899,999
Remington Model 660	From Serial #6,200,000 to #6,899,999
Remington Model XP-100	From Serial # 0001 to #7,507,983

No guns of above models that carry a letter prefix "A" or "B" in the serial numbers are involved. XP-100's with an "A" or a "B" prefix or numbered between 7,507,984 and 7,509,999 are not involved.

What to do during visits:

1. Do not release the procedure you brought with you from Ilion.
2. Talk each gunsmith through actual repair of 5-10 guns.
3. Tell them of the null position only if asked. Show them how the lift tolerance was increased.
4. Be sure they check the following clearances during repair:
 - a. Put screwdriver on top of sear, pull trigger, and push sear down; on release, sear should retract to upper position.
 - b. Receiver - bolt lock slot.
 - c. Stock reinforcing screws - through magazine well.
 - d. Stock - side clearance for safety arms, and on and off positions for full detent.
 - e. Trigger clearance on trigger guard.
 - f. Check safety several times after assembly in on and off positions, including pull of trigger each time.
 - g. Do not make any pull or engagement adjustments in this repair (lighter pull or change the engagement).

E. G. Larson

EGL:lb

PLAINTIFF'S
EXHIBIT

3056

AL 0022690

10-1