

-3-

German Mauser

- B. Excessive breech gas pressure.
- E. Breech gas pressure broke Extractor.
- F. Breech gas pressure cocked Firing Pin.
- G. Breech gas pressure cocked Firing Pin and disintegrated stock.
- L. Final strength of gun. Face of Bolt Head completely cracked.

Model 70 Winchester

- B. Excessive breech gas pressure.
- D. "
- E. "
- F. Excessive breech gas pressure cocked Firing Pin. Broke Extractor.
- G. Brass from ruptured cartridge leaving gun and lodging in bolt sleeve.
Primer leaves primer pocket.
- J. "
- K. Stock disintegrated because of excessive gas pressure. Brass from ruptured
cartridge leaving gun.
- L. Final strength of gun. Receiver disintegrated.

1903 Springfield

- B. Excessive breech gas pressure cocks Firing Pin.
- D. "
- E. Excessive breech gas pressure broke Extractor.
- F. Brass from ruptured cartridge case leaving gun, lodging in bolt sleeve.
Primer leaves primer pocket.
- G. "
- J. Final strength of gun. Receiver cracked on right side of breech ring. Stock
disintegrated.

W. E. Leek/mc
7/18/47