

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE



March 26, 1975

TO: E.G. LARSON

FROM: G.W. MARTINSUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

The safety was checked on a total of 354 rifles.

We used three (3) methods, as follows:

- A. Safety was placed in "mid" position, trigger was then pulled, and then the safety was released.
- B. Safety was placed in "mid" position, trigger was pulled, safety was then placed on safe, and the safety was next released.
- C. Safety was in fully on position, trigger pulled (very hard), and safety was released. *Note: This check was not made on first five (5) guns - reason, Bill Carter was checking these.

Results:

| | |
|---|------------|
| Total guns unable to "trick"..... | 39 |
| Total guns "tricked" by A or B (above)..... | 154 |
| Total guns "tricked" by both A and B | 152 |
| Total guns "tricked" by C..... | 4 |
| | <u>349</u> |
| | <u>+ 5</u> |
| | 354 |

Grand total-315 rifles out of 354 could be tricked.

Codes for 350 rifles.

| | |
|------------------|------------|
| CU Apr. 71..... | 23 |
| KU May 71..... | 2 |
| AW Mar. 72..... | 7 |
| PX June 73..... | 3 |
| OX July 73..... | 23 |
| RX Nov. 73..... | 43 |
| XX Dec. 73..... | 175 |
| BY Jan. 74..... | 31 |
| CY Apr. 74..... | 2 |
| DY Sept. 74..... | 41 |
| | <u>350</u> |

(continued)

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE

Remington

-2-


SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

Codes for the four (4) rifles that would fire by "C" method:

RX Nov. 73.....2
XX Dec. 73.....1
BY Jan. 74.....1
4

Les Freer, Houston Gunsmith, was contacted. He repairs the 600 in one or two ways. He said that sometimes it is just a matter of trigger adjustment and other times it needs a new safety. Les said that prior to 1973 repairs of this nature were rare.

Sincerely,


G.W. Martin, Supervisor
Firearms Product Service

GWM:tpg