Remigton Model 710 Trial and Pilot Test 100 rd. Function Test B-11 to B-20

Rem. R30064, 180 gr.SP

K28G B 14

0

Rem. R30065, 180 gr. PSP Rem. R30067, 220 gr. SP

L20 DA28 M06N B26 1 stem low, mag follower binding, replaced mag box

(

Technician-

3820

Bob Lee

Comments Noted- Grip Cap came off @ 51 rds.

Note- Replaced magazine with a new mag, supplied by Mayfield and resumed testing with no further malfunctions.

GUN #	Serial #	Ammo Types	Lot#	Malfunctions	
B16	71001580	Rem. L30062, 150 GR. MC	M02 GC1	0	
·		Rem. PRT3006B, 165 gr. NBT	M01 NC0525	0	
		Rem. R30064, 180 gr.SP	K28G B 14	0	
		Rem. R30065, 180 gr. PSP	L20 DA28	0	, 4
		Rem. R30067, 220 gr. SP	M06N B26	0	्रिकेट १ ४३
Technician-	Jeff Wade			्र होते. हे पुरस्कृत	
Comments Noted-	oiled bolt @ 9 rds.			## ³	. 3 83

GUN#	Serial #	Ammo Types	Lot#		Malkinctions
B-17	71001	583 Rem. L30062, 150 GR. MC	M02 GC1	724 G	5g 🔆
		Rem. PRT3006B, 165 gr. NBT	M01 NC0525		
		Rem. R30064, 180 gr.SP	K28G B 14		^
		Rem. R30065, 180 gr. PSP	L20 DA28	ገለፈዋሉ ፣ <u>በ</u> ዚያ የአትሪድ መጀር	ီ 0
		Rem. R30067, 220 gr. SP	MOGN B26	7 (1) (1) (1) (1) (1) (1) (1) (1) (1) (1)	0
Technician-	Jeff Wade		AMOON BEO		
Comments Note	d- Magazine diffic	ult to remove 💥 🤼			

\$40590

#_	Serial #	Amme Types	Lot#	Malfunctions	
B-18	71001	564 Reng 130062, 150 GR. MC	M02 GC1	1 stem low, mag follower binding, replaced mag box	
	3/10/20 10/10/20 10/10/20/20	Rem PRT3006B, 165 gr. NBT	M01 NC0525	0	
j		Rem. R30064, 180 gr.SP	K28G B 14	0	
Ì		Rem. #30064, 180 gr.SP Rem. #30065, 180 gr. PSP Rem. #30067, 220 gr. SP	L20 DA28	0	
12665	ğ <u>5</u> (Rem. R30067, 220 gr. SP	M06N B26	0	
Technicia	Jeff Wade				
Commen	ts Noted- Box Stop brok	e, replaced with bolt stop from B-1 with 51	10 rds.		
Note- Replaced magazine with a new mag. supplied by Mayfield and resumed testing with no further malfunctions.					

GUN#	Serial #	Ammo Types	Lot#	Malfunctions
B-19	710015	595 Rem. L30062, 150 GR. MC	M02 GC1	1 stem low, mag follower binding, replaced mag box
		Rem. PRT3006B, 165 gr. NBT	M01 NC0525	2 fail to extract, extractor sticking, replaced bolt
		Rem. R30064, 180 gr.SP	K28G B 14	0
		Rem. R30065, 180 gr. PSP	L20 DA28	0
		Rem. R30067, 220 gr. SP	M06N B26	0
Technician-	Jeff Wade			
Comments Not	ted- Grip Cap came	off @ 58 rds. and oiled bolt @ 21 rds.		
Note- Replaced	d magazine with a ne	w mag. supplied by Mayfield and resume	ed testing with no furt	her malfunctions.
Note- replaced	bolt with bolt from B	-2, check headspace @ min. +.003		

GUN#	Serial #	Ammo Types	Lot#	Malfunctions	
B-30	71001789	Rem. L30062, 150 GR. MC	M02 GC1	0	
	1	Rem. PRT3006B, 165 gr. NBT	M01 NC0525	0	
	1	Rem. R30064, 180 gr.SP	K28G B 14	0	