

## Firearm Recalls/Safety Warnings

### Firearm Recalls & Warnings Index

#### **REMINGTON ARMS MODEL 1911, SHOTGUNS**

**WARNING:** Older model Remington 1911 Shotguns may have the potential for **UNINTENTIONAL DISCHARGE**.

There should be a fiber washer located in the rear hump of the receiver which prohibits the bolt assembly from coming back to the rear of the receiver. This washer has an opening in the center to provide clearance for the rear of the firing pin which is in the center of the bolt assembly which protrudes approximately 1/8 of an inch beyond the rear. When the washer is removed or missing and the bolt is jammed into the rear of the receiver the shotgun could unintentionally discharge.

**Remington Arms  
14 Hoefler Avenue  
Illion, NY 13357**

**Source:**

- AFTE Journal, 1973; Volume 5, Number 3:21

#### **REMINGTON MODEL XP-100, PISTOLS**

**RECALL:** Remington Arms Model XP-100 bolt action pistols manufactured before February 1975 and between January 1, 1987 and October 4, 1988 have been withdrawn from sale temporarily for correction of trigger assembly mechanisms.

This action was taken because a limited number of pistols produced during that time period may have an improperly installed part in the trigger assembly mechanism. Although it is unlikely, the affected part could inadvertently allow the pistol to fire when the bolt is closed or when the safety is released.

The company is now undertaking a program to identify and recover all pistols made and sold during this period. As a precaution, Remington will, at no charge, correct the affected trigger assembly part in all pistols that could possibly be involved.