Ken Nickeson

From: David Agata

 Sent:
 11/05/2005 10:08:12 AM

 To:
 snipersonline@list1.netnet.net

CC: BCC:

Subject: Re: [snipersonline] Failure to fire

I knew that, cause he told me that...
What he said,
Agata
Crime and Storm Fighter
On 11/3/05 7:57 PM, "Charles Milazzo" <crmrifle@yahoo.com> wrote

Trent,

This is not as uncommon as a lot of folks think. When the rifte has been cleaned and checked as you have already done, and no cause found, failure to fire is usually a result of the bolt handle not being in the fully closed position when the trigger is pressed. Normally when the bolt is closed and the trigger pressed, the trigger releases the sear, which then releases the striker to move forward into the primer, with enough force to cause the primer to fire. But, if the bolt sort fully closed, the cocking lug of the striker encounters the cocking cam or ramp on the bolt, which impedes the strikers progress toward the primer. Some of the energy normally imparted to the primer, that would cause it to fire, is transferred to the cocking ramp, thus closing the bolt and masking the cause of the problem. The amount of that energy redirection varies according to the degree the bolt handle is lifted out of battery. The fact that yo! u didn't have any dent at all in the primer indicates the bolt handle was pretty far out of battery. This can occur at any time, but I see it most often during training sessions where rapid follow ups, position, movement to a hide before firing, or switching over from spotter to sniper is being trained or practiced. To avoid it, make a habit of always checking to be sure the bolt is fully closed before attempting to fire your rifle. I have seen and heard startes of some very seasoned shooters that have been caught by this all to easily occuring problem.

Hope that helps some,

Charlie

warhorse6@aol.com wrote:

-- DO NOT FORWARD electronically or through printed text-

--All material is the intellectual property of the author and/or Snipersonline UA. Copyright restrictions apply.--

Recently our sniper team was conducting our monthly training and I had something happen to me that I have never encountered before. I had a failure to fire with a live round. I immediately conducted a malfunction drill and the second round went off. I then recovered my round and observed that the primer did not have arry sign of a dent from the firing pin. I then finiished conducting training and fired approximately 32 rounds with out any further problems. After training I cleaned my rifle and disassembled my bolt. To my surprise I did not find anything wrong with it. Initially I thought my firing pin may have broken. The firing pin spring on my Remington 700 is the factory original an! d it is placed on the firing pin so tightly that it has curves from the compression. I then took the bolt to a local gunsmith